

Magnetic drilling machine

# ECO.100/4

*with 2-way electromagnet and fixed base*

# ECO.100/4 D

*with 2-way electromagnet and swivel base*

Serial number:

Date of purchase:

**Don't forget to register your machine at:**

**[www.euroboor.com/register](http://www.euroboor.com/register)**

**[ only when registered you benefit from extended warranty ]**

Congratulations on purchasing this premium magnetic drilling machine. At EUROBOOR we strive to exceed our customers' expectations by developing and providing premium and innovative portable drilling and cutting solutions. We believe that a professional like you must be able to rely on a professional supplier. Which has led us to become a major player in the industrial world, with our own factory and several offices worldwide. All because we have always listened to our customers and to the demands from the market.

Our vision is focused on developing innovative portable tools that add value for our customers and facilitate them in their daily work. We never lose sight of sustainability, time savings and cost savings.

Enjoy your new machine!

Before operating your new magnetic drilling machine, please first read all instructions. You find the instructions in this manual and on the warning label on your machine. With proper use, care and maintenance your machine will provide you with years of premium drilling performance.

**TO REDUCE THE RISK OF INJURY USER MUST READ AND UNDERSTAND ALL INSTRUCTIONS**

To view all our offices and their contact information please visit: [www.euroboor.com](http://www.euroboor.com)

# Table of contents

ECO.100/4.....	1
ECO.100/4 D.....	1
<b>Table of contents .....</b>	<b>3</b>
<b>1. Safety.....</b>	<b>4</b>
1.1 General safety instructions .....	4
1.2 Specific safety information.....	6
<b>2. Description.....</b>	<b>8</b>
2.1 Intended use.....	8
2.2 Description and features .....	8
2.3 Case content.....	9
2.4 Serial number .....	9
2.5 Technical data.....	10
2.6 Symbols .....	11
2.7 Environmental .....	12
<b>3. Preparation &amp; adjustment .....</b>	<b>13</b>
3.1 Assembly .....	13
3.2 Prior to use .....	14
<b>4. Using the machine.....</b>	<b>16</b>
4.1 Control panel .....	16
4.2 Electromagnet .....	16
4.3 Morse taper arbor .....	19
4.4 Manual gearbox.....	20
4.5 Switching motor on and off.....	20
4.6 Motor rotation .....	20
4.7 Motor speed control .....	21
4.8 Torque control.....	21
4.9 Overheat protection.....	21
4.10 Tool lubrication .....	21
<b>5. Working with drilling accessories .....</b>	<b>22</b>
5.1 Annular cutters.....	22
5.2 Twist drills.....	24
5.3 Tapping.....	26
5.4 Countersinks.....	27
<b>6. Maintenance .....</b>	<b>28</b>
<b>7. Trouble shooting .....</b>	<b>30</b>
<b>8. Exploded views &amp; spare parts list.....</b>	<b>32</b>
8.1 Exploded views .....	32
8.2 Spare parts lists .....	34
8.3 Wiring diagram .....	42
8.4 Warranty and service .....	43

# 1. Safety

## 1.1 General safety instructions

Do not use this magnetic drilling machine before you have thoroughly read and completely understood this manual, specifically the “General safety instructions” and “Specific safety information”, including the figures, specifications, safety regulations and the signs indicating DANGER, WARNING and CAUTION.



**WARNING:** *When using electrical tools basic safety precautions should always be followed to reduce the risk of fire, electrical shock and personal injury.*

Please also observe the relevant national industrial safety regulations. Non-observance of the safety instructions can lead to an electric shock, burns and/or severe injuries.

This manual should be kept for later use and enclosed with the magnetic drilling machine, should it be passed on or sold.

### Work area

1. Keep your work area clean and well lit. Cluttered and dark work areas increase the chance of accidents;
2. Do not operate a magnetic drilling machine in explosive atmospheres, such as in the presence of flammable liquids, gases or dust. A magnetic drilling machine may create sparks which could ignite the dust or fumes;
3. Keep bystanders, children and visitors away while operating a magnetic drilling machine. Distractions can cause you to lose control.

### Electrical safety

1. A magnetic drilling machine plug must match the outlet. Never modify the plug in any way. Do not use any adapter plugs;
2. Avoid body contact with grounded surfaces such as pipes, radiators, ranges and refrigerators. There is an increased risk of electric shock if your body is grounded;
3. Do not expose the magnetic drilling machine to rain or wet conditions. Water entering a machine will increase the risk of electric shock;
4. Do not abuse the cord. Never use the cord to carry the magnetic drilling machine or pull the plug from an outlet. Keep the cord away from heat, oil, sharp edges or moving parts. Replace damaged cords immediately. Damaged cords increase the risk of electric shock;
5. When operating a magnetic drilling machine, use an extension cord suitable for outdoor use, this reduces the risk of electric shock;
6. If operating a magnetic drilling machine in a damp location is unavoidable, use a residual current device (RCD), this reduces the risk of electric shock.

## Personal safety

1. Stay alert, watch what you are doing and use common sense when using a magnetic drilling machine. Do not use the machine while tired or under the influence of drugs, alcohol, or medication. A moment of inattention while operating a magnetic drilling machine may result in serious personal injury;
2. Dress properly. Do not wear loose clothing or jewelry. Keep your hair, clothing and gloves away from moving parts. Loose clothes, jewelry, or long hair can be caught in moving parts;
3. Avoid accidental starting. Be sure the switch is off before plugging the machine in. Carrying a magnetic drilling machine with your finger on the switch or plugging in a magnetic drilling machine that has the switch on increases the change of accidents;
4. Never place hands, fingers, gloves or clothing near drilling area or rotating machine parts;
5. Remove adjusting keys or switches before turning the machine on. A wrench or a key that is left attached to a rotating part of the machine may result in personal injury;
6. Do not overreach. Keep proper footing and balance at all times. Proper footing and balance enables better control of the magnetic drilling machine in unexpected situations;
7. Use safety equipment. Always wear eye protection. Dust mask, non-skid safety shoes, hard hat and hearing protection must be used for optimal safety;
8. Always use supplied safety chain during any work on non-horizontal surfaces. Magnetic drilling machine can release from surface.



**WARNING:** *Wear ear and eye protection when using this machine.*

## Machine use and care

1. When using the machine on non-horizontal surfaces, you must use cutting paste. Do not use oil because the oil can drip into the motor unit;
2. While operating the machine, the annular cutter must be cooled and lubricated with high quality cutting lubricants;
3. Always remove the slug from the annular cutter after each hole.



**CAUTION:** *The slug is sharp and may be hot!*

4. Use clamps or other practical solutions to secure and support the workpiece to a stable platform. Holding the workpiece by hand or against your body is unstable and may lead to loss of control;
5. Do not use the machine when the switch does not turn it on or off. Any machine that cannot be controlled with the switch is dangerous and must be repaired;
6. Disconnect the plug from the power source before making any adjustments, changing accessories or storing the tool. Such preventive safety measures reduce the risk of starting the tool accidentally;
7. Store your magnetic drilling machine out of reach for children and other untrained persons. Tools are dangerous in the hands of untrained users;
8. Maintain your machine with care. Keep cutting tools sharp and clean. Properly maintained tools, with sharp cutting edges are less likely to break and are easier to control;
9. Check for misalignment of moving parts, breakage of parts and any other condition that may affect the machine's operation. If you detect damage have the machine serviced before use. Many accidents are caused by poorly maintained tools;
10. Only use accessories that are recommended by EUROBOOR for your machine model. Accessories that are suitable for one machine may become hazardous when used on another machine.

## Service

1. Tool service must be performed only by qualified repair personnel. Service or maintenance performed by unqualified personnel could result in risk of injury;
2. When servicing a tool, use only identical replacement parts. Follow instructions in the maintenance section of this manual. Use of unauthorised parts or failure to follow maintenance instructions may create a risk of electric shock or injury;
3. EUROBOOR offers Armature kits containing official EUROBOOR spare parts suitable for your magnetic drilling machine.

## 1.2 Specific safety information

- Keep your fingers away from the drilling area;
- Avoid touching the slug that is automatically ejected by the pilot pin when the working procedure is finished. Contact with the slug when it is hot, or if it falls, can cause personal injuries;
- Always use the safety guard. Before switching on the machine ensure that the guard is closed securely;
- Always use the safety chain;
- The magnetic drilling machine is suitable for use on steel with a thickness starting from 6 mm, with zero air gap between the magnet core surface and the mounting surface. Curvature, coats of paint and surface irregularities will create an air gap. Keep the air gap to a minimum;
- Always place the machine on a flat surface;
- Do not clamp the magnetic drilling machine on small or irregular shaped objects;
- Always place the machine on a surface that is clear of shavings, chips, swarf and surface dirt;
- Keep the magnet clean and free of debris and swarf;
- Do not switch on the machine before checking whether the magnetic stand has been tightened firmly to the mounting surface;
- Adjust the machine so cutter does not extend into the workpiece before drilling. Do not perform any design, assembly or construction activities on the workpiece while the machine is switched on;
- Before switching on the machine, make sure all accessories have been mounted correctly;
- Do not switch on the machine until it has been mounted and installed according to all above mentioned instructions;
- Always use the recommended speed for the accessories and material you are working with;
- Do not use the machine on the same workpiece on which electric welders are working;
- Only use an appropriate cutting lubricant. EUROBOOR offers a wide range of well-considered cooling and lubrication products to match your requirements;
- Do not use liquid cutting fluids while drilling vertically or overhead. Dip the cutter in cutting paste or apply an appropriate spray for these applications;
- Do not pour cutting fluid into the reservoir while it is mounted in the bracket. Do not allow cutting fluid to enter the drill motor;
- Before use, ensure movable safety guard operates properly;
- In case of a jammed cutter, turn off the machine, disconnect the machine from the power supply and then remove the reason for the jam before turning on the machine again.

## **Residual risk**

In spite of following the relevant safety regulations and their implementation, certain residual risks cannot be avoided. These are:

- Impairment of hearing;
- Risk of personal injury from flying particles;
- Risk of burns due to accessories becoming hot during operation;
- Risk of personal injury due to prolonged use.


Always try to reduce these risks as much as possible.

# 2. Description

## 2.1 Intended use

This magnetic drilling machine is intended for commercial use as a drilling machine for drilling materials with a magnetisable surface using annular cutters and twist drills, and for countersinking in a weather-protected environment using the application tools and accessories recommended by EUROBOOR. The magnetic drilling machine can be used horizontally, vertically or overhead.

## 2.2 Description and features

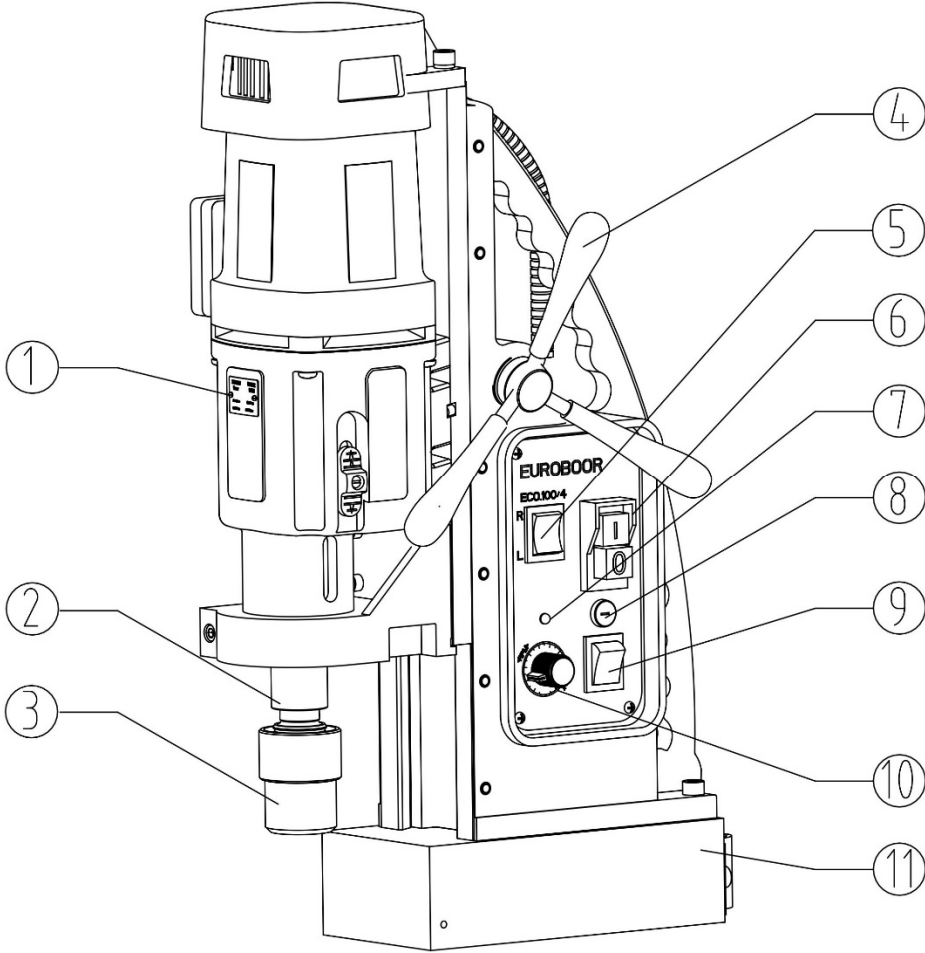

[image 2-1]

- 1 Gearbox guide
- 2 Output shaft
- 3 Morse taper spindle
- 4 Feed handle
- 5 L/R switch
- 6 Motor switch
- 7 Magnet LED indicator
- 8 Fuse holder
- 9 Magnet switch
- 10 Speed control knob
- 11 Electromagnet



## 2.3 Case content

- 1 x ECO.100/4 (D) Magnetic drilling machine
- 1 x safety guard
- 3 x handles
- 1 x hex key 2.5 mm
- 1 x hex key 4 mm
- 1 x hex key 5 mm
- 1 x hex key 6 mm
- 1 x hex key 8 mm (ECO.100/4 D only)
- 1 x stop pin
- 1 x lubrication system
- 1 x safety chain
- 1 x bottle (200 ml) of IBO.10 cutting oil
- 1 x arbor MT 3 - 19.05 mm (3/4"), including lubrication ring
- 1 x Morse taper ejector drift key
- 1 x user manual
- 1 x safety ear protection
- 1 x safety goggles
- 1 x safety gloves

## 2.4 Serial number

The serial number is mentioned on the machine three times: engraved on the frame, engraved on the magnet and on the serial no. sticker on the motor housing. Additional serial no. stickers are provided with the machine for your administration.

The serial number will help you, your dealer and EUROBOOR to validate and identify the machine.

For example:

1002006001

breaks down to:

*100 20 06 001*

Machine series

Year of manufacture







Month of manufacture

Identification number

## 2.5 Technical data

	<b>Metric</b>	<b>Imperial</b>
<b>Annular cutting</b>	∅ 12 - 100 mm	∅ 1/2" - 13 15/16"
<b>Twist drilling</b>	∅ 1 - 31.75 mm	∅ 1/16" - 1 1/4"
<b>Threading</b>	M3 - M30	1/8" - 1 3/16"
<b>Countersinking</b>	∅ 10 - 105 mm	∅ 3/8" - 4 1/8"
<b>Length</b>	365 mm	14 3/8"
<b>Width</b>	310 mm	12 3/16"
<b>Height (ECO.100/4)</b>	510 - 710 mm	20 1/16" - 27 15/16"
<b>Height (ECO.100/4 D)</b>	519 - 719 mm	20 7/16" - 28 5/16"
<b>Stroke</b>	260 mm	10 1/4"
<b>Weight (ECO.100/4)</b>	28.0 kg	61.7 lbs
<b>Weight (ECO.100/4 D)</b>	31.2 kg	68.8 lbs
<b>Magnet (l x w x h)</b>	220 x 110 x 64 mm	8 11/16" x 4 5/16" x 2 1/2"
<b>Magnetic force</b>	3,000 kg	6,614 lbs
<b>Motor power</b>	1,900 W	15.5 A
<b>Total power</b>	2,050 W	16.7 A
<b>Speed (no load)</b>	(I) 42 - 110 rpm (II) 65 - 190 rpm (III) 140 - 400 rpm (IV) 220 - 620 rpm	
<b>Speed (1,900 W load)</b>	(I) 85 rpm (II) 152 rpm (III) 270 rpm (IV) 480 rpm	
<b>Spindle (Weldon)</b>	MT3 19.05 mm	MT3 3/4"
<b>Voltage</b>	220 - 240 V / 50 - 60 Hz	110 - 120 V / 60 Hz

## 2.6 Symbols

Symbol	Term, meaning	Explanation
	Read documentation	Be sure to read the documentation in this user manual and specifically the “General safety instructions” and “Specific safety information”
	Wear ear protection	Use ear protection during operation
	Wear eye protection	Use eye protection during operation
	Danger/warning/caution	Read and apply the information in the adjacent text!
	European conformity symbol	Confirms the conformity of the magnetic drilling machine with the directives of the European Community
	Class of protection I	Product with basic insulation and exposed (touchable) conductive parts additionally connected to the protective earth conductor
mm	Millimeter	Unit of measure for the dimensions
"	Inch	Unit of measure for the dimensions
kg	Kilogram	Unit of measure for the mass
lbs	Pound	Unit of measure for the mass
V	Volt	Unit of measure for the electric voltage
A	Ampere	Unit of measure for the electric current intensity
W	Watt	Unit of measure for the output
rpm	Revolutions per minute	Unit of measure for the revolutions

## 2.7 Environmental



Separate collection. This product must not be disposed of with normal household waste.



Separate collection of used products and packaging allows materials to be recycled and used again. Re-use of recycled materials helps prevent environmental pollution and reduces the demand for raw materials.

Local regulations may provide for separate collection of electrical products from the household, at municipal waste sites or at the retailer when you purchase a new product.

## 3. Preparation & adjustment

### 3.1 Assembly



**WARNING:** To reduce the risk of injury, turn machine off and disconnect from power source before installing and removing accessories, before adjusting or changing set-ups or when making repairs. Be sure all switches are in the OFF position. An accidental start-up can cause injury.

#### Fitting the feed handles

Fit each of the three feed handles by screwing them into the hub in clockwise direction; Tighten firmly by hand.

The handles are supposed to face slightly outward. Be careful not to cross-thread any of the components.


#### Mounting the safety guard

The safety guard protects against chippings and accidental contact and must always be mounted before operation:

1. Hold the guard in front of the magnet, align the slots in the guard with the holes in the magnet;
2. Fit the screws into the holes located in the side of the magnet.



**WARNING:** Always use the safety guard.

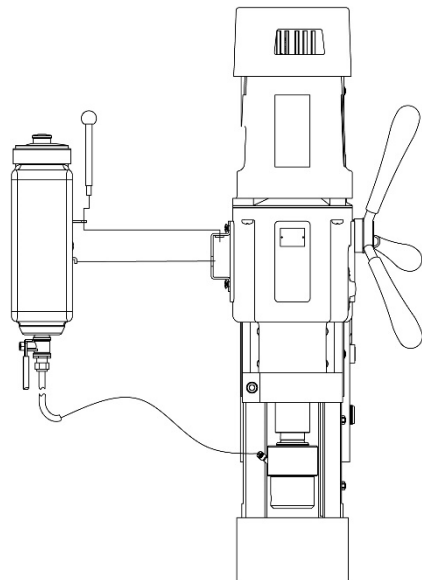

#### Fitting the lubrication system

The lubrication system can only be used for horizontal drilling (the drill being used vertically).

1. Hang the tank on the tank holder;
2. Position and tighten the attachment pin;
3. Connect the hose to the fitting on the gearbox. Make sure the hose is connected fully and tightly;
4. To disconnect the hose, press the blue ring on the connection and gently pull out the hose.

[image 3-1]

In order to use the lubrication system, it must be filled with a sufficient amount of cutting fluid.

1. Make sure the flow regulator is closed;
2. Unscrew the cap;
3. Fill the container with cutting fluid;
4. Screw the cap back on.



**WARNING:** Do not use the lubrication system in vertical or overhead drilling applications. Instead use EUROBOOR cutting paste or spray.

### Fitting the safety chain

1. Pass the safety chain through the frame grip opening;
2. Wrap the chain around the workpiece;
3. Securely close the chain using the lock.



**WARNING:** Always use the safety chain when drilling vertically and/or upside down. The safety chain does not replace the magnetic force of the magnetic drilling machine: it is simply used to secure against falling in the event of a magnet malfunction.

### 3.2 Prior to use

Please make sure that the contacting surface for the magnet is level, clean and rust free. Remove any varnish or primer. When working on materials that are not magnetisable, suitable fixation devices, obtainable as accessories from EUROBOOR, e. g. suction plate, vacuum plate or pipe-drilling machine must be used.

When working on steel materials with a material thickness of less than 6 mm, the workpiece must be reinforced with an additional steel plate in order to guarantee the magnetic holding power.

Check the machine for possible damage; Before using the machine, you must carefully check the protective components or slightly damaged components to ensure they are operating perfectly and as intended.

Check that moving parts are in perfect working order, do not jam and check whether the parts are damaged. All parts must be correctly installed and fulfill all conditions necessary to ensure perfect operation of the machine.

Damaged protective components must be repaired or replaced according to specifications by EUROBOOR or any authorised EUROBOOR dealer.

**DO NOT** use under wet conditions or in presence of flammable liquids or gases.

**DO NOT** let children come into contact with the machine. Supervision is required when inexperienced operators use this machine.

### Electrical safety

The electric motor has been designed for one voltage only. Always check that the power supply corresponds to the voltage on the rating plate.

Your EUROBOOR magnetic drilling machine is designed in class I (grounded) according to EN 61029-1. Earth wire is required.

If the supply cord is damaged, it must be replaced by a specially prepared cord available at EUROBOOR or your EUROBOOR dealer.

### Extension cable


If an extension cable is required, use an approved 3-core extension cable suitable for the power input of this machine (see technical data). The minimum conductor size is 1.5 mm<sup>2</sup>; the maximum length is 30 metre. When using a cable reel, always unwind the cable completely.

### **Useful tips**

- Try a few simple projects using scrap material until you develop a “feel” for the magnetic drilling machine;
- Let the machine run in for a period of eight to ten hours before starting with big operations. Do not load the machine too much during this run-in period;
- Never use the machine with serious overload;
- Keep the machine clear from moisture at all times to protect the machine, yourself and others.

# 4. Using the machine


 **WARNING:** Always observe the safety instructions and applicable regulations.

 **WARNING:** To reduce the risk of serious personal injury, turn the machine off and disconnect the machine from power source before making any adjustments or removing/installing attachments or accessories.

## 4.1 Control panel

The control panel on your magnetic drilling machine is designed for maximum ease of use and safety.

- 1. Magnet switch
- 2. Speed control knob
- 3. Fuse holder
- 4. Magnet LED indicator
- 5. Motor switch
- 6. L/R switch

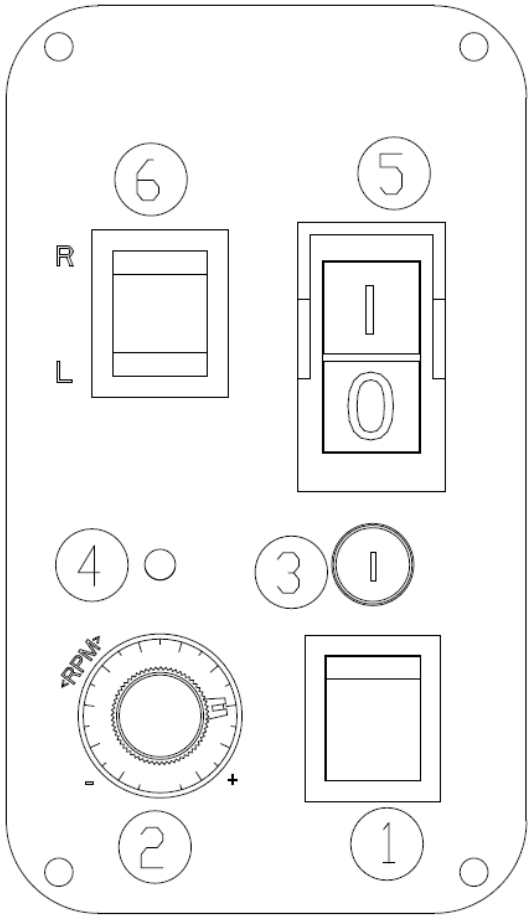


[image 4-1]

## 4.2 Electromagnet

Make sure the magnetic drilling machine is placed on a smooth, clean, level and solid surface without any objects or debris to guarantee maximum adhesion.

The workpiece must at least be 6 mm (1/4") thick for the magnet to stick and to drill safely. In case the workpiece is between 3 mm (1/8") and 6 mm (1/4"), make sure to make a proper base to create a good magnetic field as shown below.



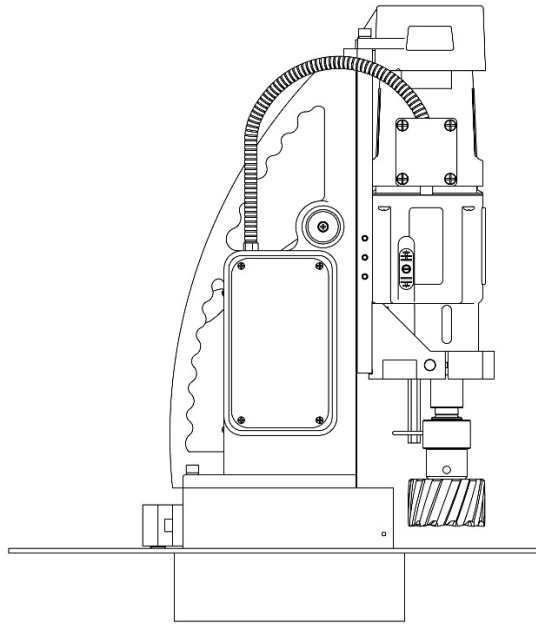

[image 4-2]

The electromagnet will work best on surfaces of at least 10 mm (3/8") thickness.

When the electromagnet is not able to create a good enough magnetic field, this may be caused by:

- Surface not being flat;
- Workpiece is not magnetisable (e.g. aluminium);
- Workpiece is coated or painted;
- Workpiece is not thick enough.

In this situation the magnet indicator will light up red. Make sure to solve any of these matters before proceeding in any way and creating unsafe situations.

### **2-Way electromagnet**

This machine is equipped with a 2-way magnet function. At half of the magnetic force (1,500 kg), the magnet sufficiently sticks to the surface to hold the machine in position while not in use. More importantly, it consumes less energy, generates less heat and as a consequence will last longer. Only with full magnetic force (3,000 kg) the machine can be used for drilling.

#### **Using the 2-way magnet:**

1. Place and position the machine on the workpiece;
2. To activate the magnet at half of the magnetic force, press the RED magnet switch. The magnet switch will be lit. The magnet LED indicator lights up GREEN when the generated magnetic force is sufficient to hold the machine in position while not drilling;
3. For full magnetic force, press the GREEN motor switch (see next paragraph);
4. To deactivate the magnet, first press the RED motor switch to return to half magnetic force and then press the RED magnet switch again.




**WARNING:** Do not use this machine when LED indicator is RED. Magnet may not generate sufficient attachment force.

**We want to point out that above mentioned precautions and indicators do not guarantee that the magnet will not release from the material. EUROBOOR accepts no liability when it comes to the magnet indicator not functioning or functioning poorly.**


Make sure that the magnet attaches tightly to the work piece before turning on the motor unit of the magnetic drilling machine. EUROBOOR magnets have two coils; make sure that both coils are in contact with the material. Do not connect any other machine to the same electrical outlet to which the magnetic drilling machine is plugged into, as it may result in the loss of magnetic force.

**Swivel base (ECO.100/4 D only)**

With the magnet properly attached to the workpiece, the swivel base allows you to rotate the machine 30° to left and right, and slide it 15-20 mm forward and backwards, relative to the magnet, for more precise positioning of the drill. To swivel the machine, loosen the screw below the frame handle with the provided 8 mm Allen key. Determine the preferred position and fix the screw before drilling.

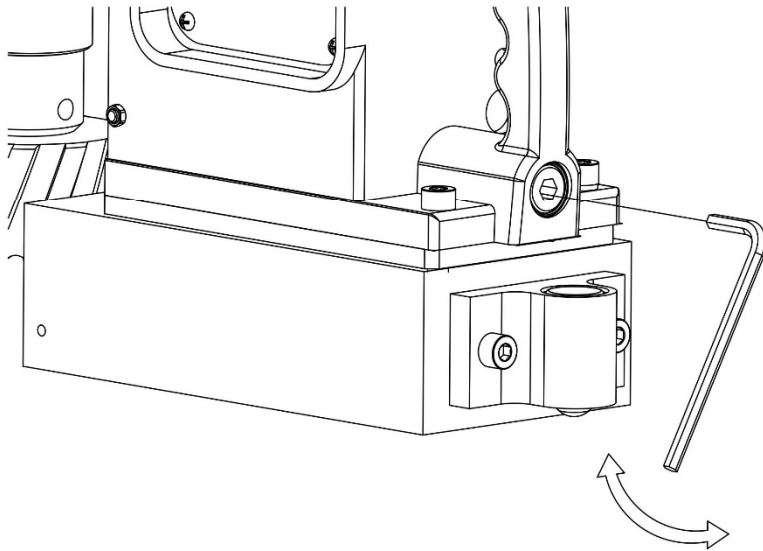


[image 4-3]

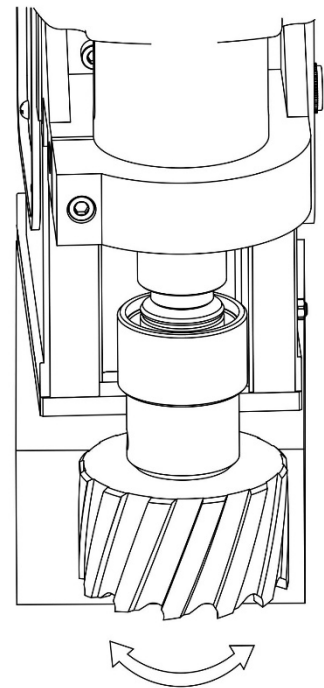


[image 4-4]

Always use the safety chain included. Drilling above your head is extremely dangerous and is not recommended. For the use of magnetic drilling machines on pipes, not-flat or non-magnetic materials, we refer to our catalogue or our website [www.euroboor.com](http://www.euroboor.com) where several vacuum tightening systems, pipe clamping systems and Tube machines can be found.

### 4.3 Morse taper arbor

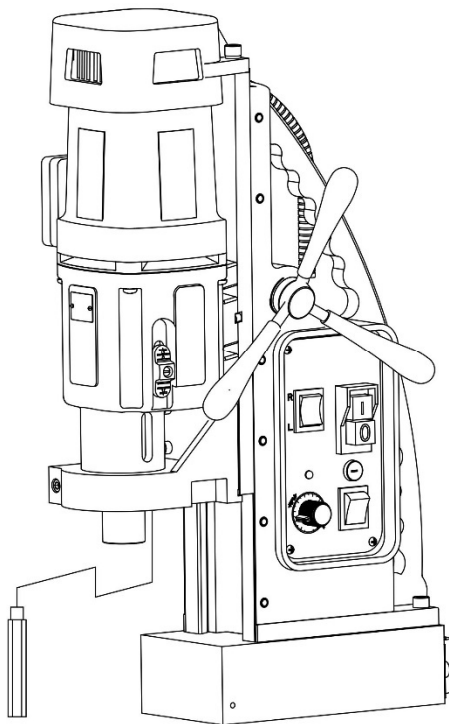


[image 4.5]

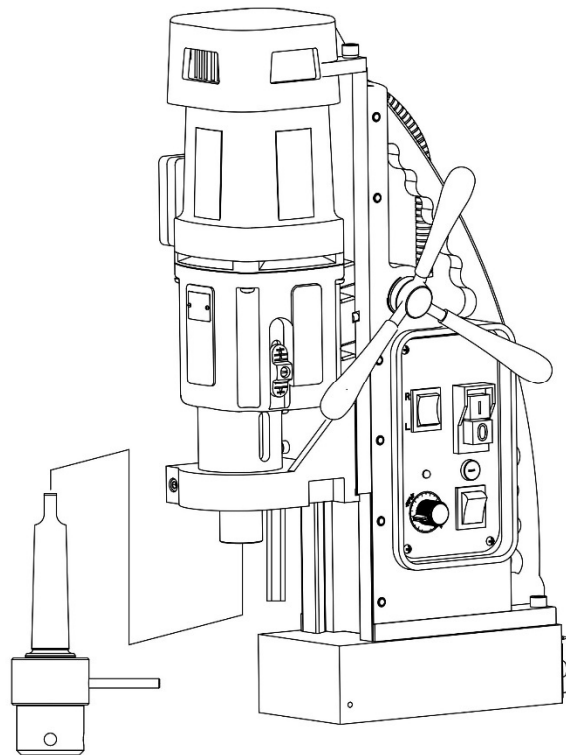

[image 4.6]

1. Make sure the inside of the output shaft and the Morse taper arbor are clean and free of grease;
2. Take the stop pin from the case and screw the threaded end in the motor bracket;
3. Position the rotation limiter on the lubrication ring of the arbor against the stop pin;
4. Firmly slide the Morse taper arbor into the output shaft by hand. Make sure the arbor is properly positioned. You should not be able to pull it out by hand;
5. To remove the Morse taper arbor:
  - Switch off the motor;
  - Rotate the mechanical gear switch to neutral (see paragraph 4.4 Gearbox);
  - Rotate the output shaft until the slots on the shaft align with the slots on the gearbox;
  - Gently tap the supplied drift into the slots to push the Morse taper arbor out.

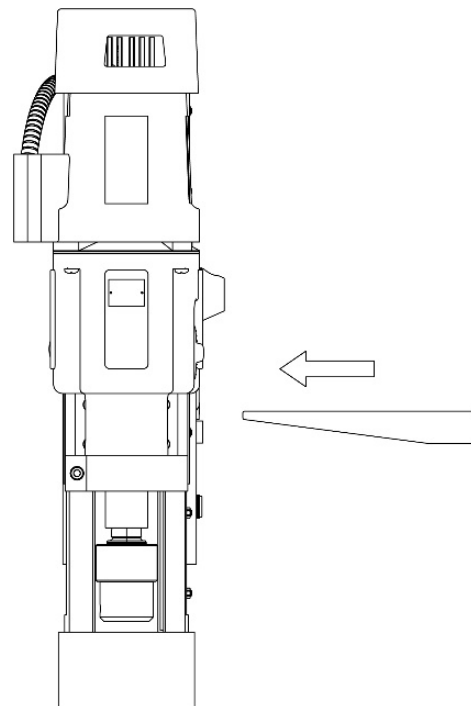

[image 4.7]


## 4.4 Manual gearbox

This machine is equipped with a 4-speed gearbox. Gear switches on both sides make it possible to select 4 different speeds manually. Select the closest gear and speed for the intended operation.

- To select the correct gear from neutral (horizontal) position:
  - Rotate the switch counter clockwise to position **o**;
  - Rotate the switch clockwise to position **oo**.
- A gear is only correctly selected when the gearbox switches are both aligned with the indicators on the gearbox:

In case you have trouble fully and correctly selecting a gear, the gears in the gearbox might be misaligned. Slightly rotating the output shaft by hand will help you to align the gears and correctly and fully select the intended gear;
- Speed selection for annular cutters (also see plate on gearbox):

Front switch	Back switch	Speed	Cutter $\varnothing$	Cutter $\varnothing$
<b>o</b>	<b>oo</b>	42 - 110 rpm	12 - 26 mm	1/2" - 1"
<b>oo</b>	<b>oo</b>	66 - 190 rpm	27 - 50 mm	1 1/16" - 2"
<b>o</b>	<b>o</b>	140 - 400 rpm	51 - 79 mm	2" - 3 1/8"
<b>oo</b>	<b>o</b>	220 - 620 rpm	80 - 100 mm	3 1/8" - 3 15/16"

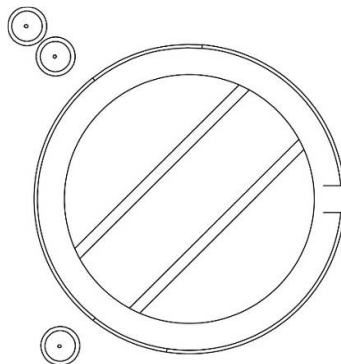

[image 4-8]

## 4.5 Switching motor on and off

The motor unit can only be switched ON when the magnet is activated. To switch the motor ON, press the green button with marking "I". To switch the motor OFF, press the red button with marking "O".

## 4.6 Motor rotation

The rotational direction of the motor can be changed:

- Switch in up position (R) will make the motor rotate clockwise;
- Switch in down position (L) will make the motor rotate counter clockwise;
- Switch in middle position will not make the motor rotate (neutral position).

Before switching the rotational direction of the motor and spindle, make sure the motor is switched OFF first, to prevent machine and tool damage.

## 4.7 Motor speed control

The speed control knob (potentiometer) allows you to electronically control the speed of the motor (in both clockwise and counter clockwise direction):

- The indicator of the potentiometer in bottom left corner is minimum speed;
- The indicator of the potentiometer in bottom right corner is maximum speed;

The electronic motor speed control works for both mechanical gears. Be careful not to overturn the knob.

## 4.8 Torque control

Built-in electronic torque control will automatically stop the motor in case of overload. Adjust the torque by turning the red rotary knob at the backside of the motor unit into the “-” direction. Then push the red motor switch with “O” marking to reset the motor, and the green motor switch with “I” marking to start drilling again.

## 4.9 Overheat protection

This machine is supplied with an all-time electronic overheat protection. If the temperature of the motor unit runs up to 70° C (158 °F) the motor unit will stop. After a few minutes it can be started again. When it is possible to start the motor again, let the motor run idle at full speed for a couple of minutes to let the motor cool down more in an efficient way.

## 4.10 Tool lubrication

### Horizontal applications

In order to use the lubrication system, the tank must be filled with a cutting lubricant.

1. Make sure the flow regulator is closed;
  2. Unscrew the cap;
  3. Fill the container with cutting lubricant;
  4. Screw the cap back on.
- Adjust the fluid flow as required using the flow regulator;
  - Add more cutting lubricant when the shavings (metal chips) become blue.

### Vertical and overhead applications

Dip the cutter in cutting paste or apply an appropriate spray.




**WARNING:** Do not use the lubrication system in vertical or overhead drilling applications. Instead use EUROBOOR cutting paste or spray.

Make sure to use only suitable cutting lubricants. EUROBOOR offers a wide range of cutting lubricants for all tool and material combinations. Proper lubrication will help you create better and faster results, and extend the lifetime of your tools.

# 5. Working with drilling accessories

## 5.1 Annular cutters

Annular cutters only cut material at the periphery of the hole, rather than converting the entire hole to shavings. As a result, the energy required to make a hole is lower than for a twist drill. When drilling with an annular cutter, it is not necessary to drill a pilot hole.

 **WARNING:** Do not touch the cutter or the parts close to the cutter immediately after operation, as they may be extremely hot and cause burns to the skin. Ensure nobody is in the work area where the metal core (slug) is ejected.

### Drilling conditions

The ease with which material can be drilled depends on several factors including tensile strength and abrasion resistance. Whilst hardness and/or strength is the usual criterion, wide variations in machinability can exist among material showing similar physical properties.


The drilling conditions are dependent on requirements for tool life and surface finish. These conditions are further restricted by the rigidity of the tool and the workpiece, lubrication and machine power available. The harder the material, the lower the cutting speed.

Some materials of low hardness contain abrasive substances leading to rapid cutting edge wear at high speeds. Feed rates are governed by rigidity of set-up, volume of material to be removed, surface finish and available machine power.

### Drilling a hole

Now that you have read the information and safety recommendations above, you are ready to actually start drilling. Follow these 12 steps for best drilling result:

1. Install the annular cutter:
  - Place the pilot pin into the cutter;
  - Align the flat faces on the cutter shank with the screws in the tool holder;
  - Make sure the cutter shank is entered fully and correctly;
  - Tighten the screws;

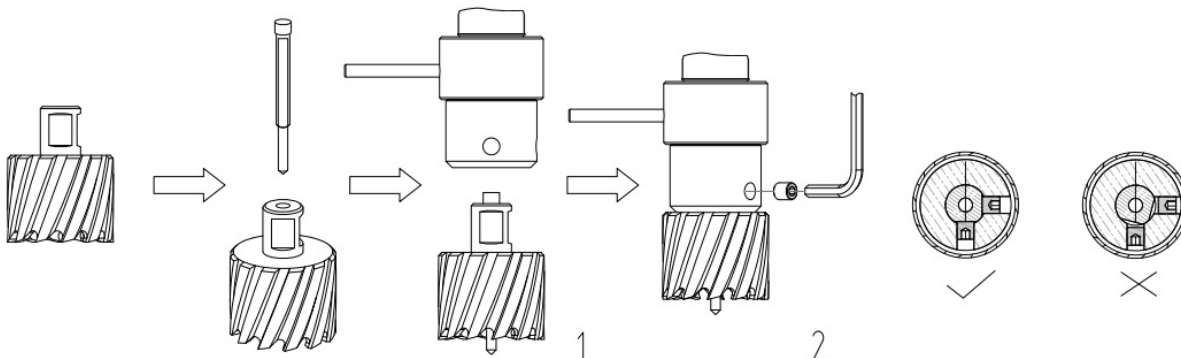

[image 5-1]

2. Precisely mark the center of the hole;
3. Use the pilot pin to position the machine in the correct position, with the tip of the pilot pin to meet the marked center of the hole;

4. Switch on the magnet and verify that the drill is in the right position and that the machine is pushed tight against the work piece;
5. Fill the holes of the spindle with oil;
6. Switch the motor on and allow it to run at the required speed;
7. Turn the feed handles to start drilling. Apply only a slight pressure when the annular cutter touches the metal. Do not push the annular cutter with force into the metal;
8. Apply a regular pressure while drilling. The drilling performance does not improve by putting more pressure on the machine. Too much pressure will overload the motor and your annular cutter will be worn sooner;

***A continuous, non-discoloured iron swarf is a sign of correct drilling speed and a well-cooled, sharp cutter. Let the cutter do the job and give it time to cut the metal!***

9. Stop drilling regularly, refill the holes of the spindle and continue drilling;
10. Apply less pressure when the drill cuts through the material. The slug will be pushed out of the cutter by the pilot pin;
11. Turn the feed handles to put the motor in highest position and switch off the motor unit;
12. Remove the burrs, metal chips and clean the cutter and surface without getting injuries.



**CAUTION:** *The slug is sharp and may be hot!*

## 5.2 Twist drills


### Weldon shank

Fit the twist drill with 19.05 mm (3/4") Weldon shank into the arbor and fasten the screws with the provided Allen key.

Follow the further steps in paragraph Annular cutters.

### Standard parallel shank (DIN338)

1. Remove the Morse Taper 3 (MT3) arbor for Weldon shanks (see paragraph 4.3 Morse Taper arbor)
2. Fit a MT3 arbor connection
  - a. EUROBOOR code 1/2UNF-MC3 for 1/2" x 20 UNF drill chuck connections
  - b. EUROBOOR code B16-MC3 for B16 drill chuck connections
3. Fit the appropriate twist drill chuck to the arbor
4. Fit the drill with parallel shank and fasten it

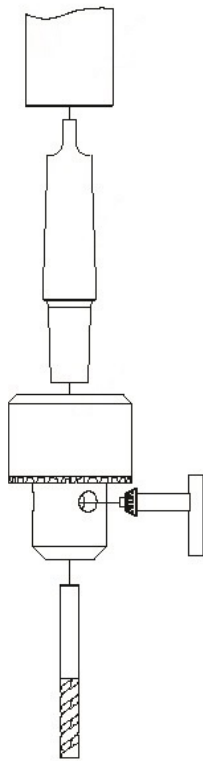

[image 5-2 | Example of fastening a drill with a key]


5. Precisely mark the center of the hole, and use the tip of the twist drill to position the machine.

For further steps see paragraph Annular cutters.




### Morse Taper shanks (MT2 or MT3)

1. Remove the Morse Taper 3 (MT3) arbor for Weldon shanks (see paragraph Morse Taper arbor)
2. Fit a twist drill with a MT3 shank
3. For twist drills with a MT2 shank fit an MT3-MT2 adapter (EUROBOOR code IBK.MC3-MC2) before fitting the drill (see below)

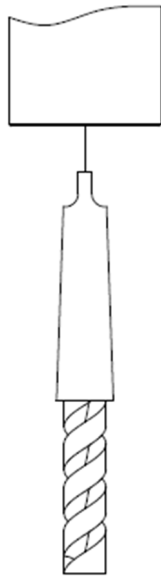

[image 5.3 | fitting drill with MT3 shank]

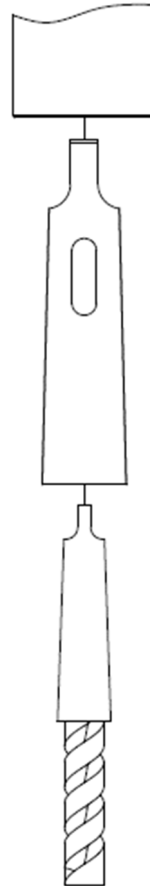

[image 5.4 | fitting drill with MT3-MT2 adapter]

4. Precisely mark the center of the hole, and use the tip of the twist drill to position the machine.

For further steps see paragraph Annular cutters.

## 5.3 Tapping

The machine is equipped with counter clockwise rotation and is suitable for tapping holes.

### Drill taps with Weldon shank


1. Fit the drill with 19.05 mm (3/4") Weldon shank into the arbor and fasten the screws with the provided Allen key
2. Select the required gear and speed and set the direction of rotation to clockwise (right = R);
3. Switch on the motor and set the drill tap onto the workpiece with the feed handles;
4. To drill and tap the hole, guide the machine slide down with the handles without exerting;
5. Switch off the motor and set the direction of rotation to counter clockwise (left = L);
6. Switch on the motor again and allow the machine tap to come completely out of the work piece;
7. Guide the motor unit slide upwards with the feed handles to avoid damaging the start of the threaded hole

### Machine taps with adapter

1. Drill a hole first;
2. Switch off the machine and change the cutter for the tap collet and machine tap;



**Warning:** do not move the machine!

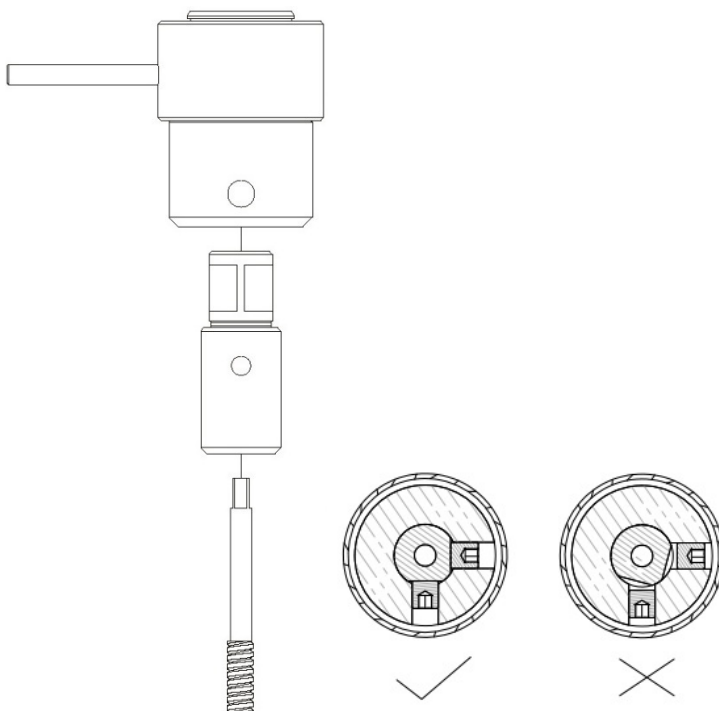

[image 5-5]

3. Select the lowest gear and speed and set the direction of rotation to clockwise (right = R);
4. Switch on the machine and set the machine tap onto the drilled hole;
5. Guide the machine slide down at the handle without exerting;
6. Switch off the machine (just before the tap is completely through the hole) and set the direction of rotation to counter clockwise (left = L);

7. Switch on the machine again and allow the machine tap to come completely out of the work piece. Then guide the motor unit slide upwards with the feed handles to avoid damaging the start of the thread.



**Warning:** do not let your tap push up the motor unit by itself!

Make sure to properly lubricate while performing tapping work, see paragraph 5.1 Annular cutters.

## 5.4 Countersinks

Thanks to its wide range of operating speeds, the machine can also be used for reaming or countersinking. Follow the steps mention in paragraph 5.2 Twist drills.

## 6. Maintenance

Your EUROBOOR magnetic drilling machine has been designed to operate over a long period of time. Continuous satisfactory operation depends upon proper tool care and regular cleaning.



**CAUTION: To reduce the risk of injury, turn the machine off and disconnect machine from power source before installing and removing accessories, before adjusting or changing set-ups or when making repairs. Be sure the switch is in the OFF position. An accidental start-up can cause injury.**

Just as every magnetic drilling machine with moving parts, your EUROBOOR magnetic drilling machine also needs regular maintenance service. A few recommendations follow :

### **Visually check the machine for damage**

The machine must be checked before operating for any signs of damage that will affect the operation of the machine. Particular notice must be taken of the main cable, if the machine appears to be damaged it should not be used. Failure to do so may cause injury or death.

### **Cleaning**

- Clean all dirt, dust, metal chips and burrs of your magnetic drilling machine;
- Blow dirt and dust out of the main housing with dry air as often as dirt is seen collecting in and around the air vents. Wear approved eye protection and an approved dust mask;
- Never use solvents or other harsh chemicals for cleaning the non-metallic parts of the tool. These chemicals may weaken the materials used in these parts. Use a cloth dampened only with water and mild soap. Never let any liquid get inside the tool; never immerse any part of the tool into a liquid.

### **Operation of the machine**

The machines operation must be checked to ensure that all components are working correctly. Replace any defective parts immediately. This prevents properly functioning parts from being damaged.

### **Check magnetic base**

Before every operation the magnetic base should be checked to make sure that the base is flat and there is no damage present. An uneven magnet base will cause the magnet to hold not as efficiently and may cause injury to the operator. When the machine is put out of use for a longer period, apply a small amount of machine oil to the underside of the magnetic base for rust protection. Clean the magnetic base again with next use.

### **Check gearbox grease**

The gearbox should be checked once a month to ensure all moving components are covered with grease to prevent wear. The grease should be changed at least once a year to ensure you gain the best from the machine.

### **Check carbon brushes**

Brushes should be checked to make sure there is no abnormal wear present. This should be checked at least once a week if used frequently. If the carbon brush has worn more than 2/3 the original length the brushes should be changed. Failure to do so may cause damage to the machine.

### **Check armature**

This should be checked at least once a month to check if there are visual signs of damage to the body or to the commutator. Some signs of wear will be seen on the commutator over a period of time this is normal as this is the part that comes in contact with the brushes but any signs of abnormal damage means the part should be replaced.

### **Adjustment of slide**

An essential requirement of the machine is that the slide can move in a smooth and controlled manner, free of lateral movement and vibration.

This situation can be maintained by periodic adjustment of the slide and can be accomplished in the following manner:

1. Place the machine in an upright position and, by means of the capstan, raise the slide to its highest position. Clean the aluminum rails and apply a small amount of light machine oil to the wear surfaces;
2. Gently feed in setting screw with supplied Allen key 2.5 until slight resistance is encountered. Follow your way down adjusting all setting nuts and screws;
3. Operate the slide up and down a few times to test the movement and make any further necessary adjustments. Try to ensure that all the screws are exerting a uniform pressure on the slide from top to bottom. A perfectly adjusted slide will operate freely up and down without any sideways movement.

### **Lubricating the feed travel**

The feed travel should be lubricated periodically with grease to ensure smooth operation.

- Raise the motor unit to the highest position possible;
- Lubricate the dove-tail guideway at both sides;
- Lubricate the gear rack.

After repeated use, the gear rack may become loose. If necessary, adjust the five self-locking set screws at the left side. Tighten screws in series until the gear rack moves freely in the dove-tail guideway but does not allow the motor to wobble.

### **Repair, modification and inspection**

Repair, modification and inspection of EUROBOOR Magnetic drilling machines must be done by EUROBOOR or an EUROBOOR authorised dealer. The spare parts list will be helpful if presented with the machine to the EUROBOOR dealer for service when requesting repair or other maintenance.

EUROBOOR machines are constantly being improved and modified to incorporate the latest technological advancements. Accordingly, some parts (i.e. part numbers and/or design) may be changed without prior notice. Also, due to EUROBOOR's continuing program of research and development, the specifications of machines are subject to change without prior notice.



**WARNING:** *Since accessories, other than those offered by EUROBOOR, have not been tested with this machine, use of such accessories with this tool could be hazardous. To reduce the risk of injury, only EUROBOOR recommended accessories should be used with this machine.*

Consult your dealer for further information on the appropriate accessories.


## 7. Trouble shooting

Magnet and motor do not function	<ul style="list-style-type: none"> <li>- The magnet switch is not connected to the power supply</li> <li>- Damaged or defective wiring</li> <li>- Defective fuse</li> <li>- Defective magnet switch</li> <li>- Defective control unit</li> <li>- Defective power supply</li> </ul>
Magnet does function, the motor does not work	<ul style="list-style-type: none"> <li>- Damaged or defective wiring</li> <li>- Carbon brushes are stuck or worn out</li> <li>- Defective magnet switch</li> <li>- Defective On / Off switch</li> <li>- Defective control unit</li> <li>- Defective armature and/or field</li> </ul>
Magnet does not function, the motor does	<ul style="list-style-type: none"> <li>- Defective magnet</li> <li>- Defective wiring of magnet</li> <li>- Defective control unit</li> </ul>
Annular cutters break quickly, holes are bigger than the annular cutter	<ul style="list-style-type: none"> <li>- Clearance in the guide</li> <li>- Bent spindle</li> <li>- Shaft extending from the motor is bent</li> <li>- Bent pilot pin</li> </ul>
Motor running roughly and/or seizing up	<ul style="list-style-type: none"> <li>- Bent spindle</li> <li>- Shaft extending from the motor is bent</li> <li>- Triangular guide not mounted straight</li> <li>- Dirt between spindle and triangular guide</li> </ul>
Motor starts running when magnet switch is turned on	<ul style="list-style-type: none"> <li>- Damage or defective relay in control unit</li> </ul>
Motor making a rattling sound	<ul style="list-style-type: none"> <li>- Gear ring (bottom of the armature) worn out</li> <li>- Gear(s) worn out</li> <li>- No oil in gearbox</li> </ul>
Motor humming, big sparks and motor has no force	<ul style="list-style-type: none"> <li>- Armature damaged (burned)</li> <li>- Field burned</li> <li>- Carbon brushes worn out</li> </ul>
Motor does not start or fails	<ul style="list-style-type: none"> <li>- Damaged or defective wiring</li> <li>- Dirt in sensor control unit</li> <li>- Defective or loose magnet on top of armature</li> <li>- Damaged or defective (sensor) control unit</li> <li>- Damage to armature or field coil</li> <li>- Damaged or defective carbon brushes</li> </ul>
Guiding takes a great deal of effort	<ul style="list-style-type: none"> <li>- Guide is set too tight</li> <li>- Guide is dry, needs to be greased</li> <li>- Guide/gear- rack/rotation system dirty or damaged</li> </ul>
Insufficient magnetic force	<ul style="list-style-type: none"> <li>- Damaged or defective wiring</li> <li>- Bottom of magnet not clean and dry</li> <li>- Bottom of magnet not flat</li> <li>- Workpiece is not bare metal</li> <li>- Workpiece is not clean or flat</li> <li>- Workpiece is less than 6 mm (too thin)</li> <li>- Defective control unit</li> <li>- Defective magnet</li> </ul>

Frame under voltage	<ul style="list-style-type: none"> <li>- Damaged / defective wiring</li> <li>- Defective magnet</li> <li>- Motor seriously dirty</li> </ul>
Fuse blows when magnet switch is turned on	<ul style="list-style-type: none"> <li>- Damaged or defective wiring</li> <li>- Wrong value fuse</li> <li>- Defective magnet switch</li> <li>- Defective control unit</li> <li>- Defective magnet</li> </ul>
Fuse blows when motor is started	<ul style="list-style-type: none"> <li>- Damaged or defective wiring</li> <li>- Wrong value fuse</li> <li>- Motor running roughly</li> <li>- Defective armature and / or field</li> <li>- Carbon brushes worn out</li> <li>- Defective control unit</li> </ul>
Rotation system free stroke too long	<ul style="list-style-type: none"> <li>- Loose or defective gear rack</li> <li>- Defective rotation system</li> </ul>
Red blinking light in top display with beeping sound	<ul style="list-style-type: none"> <li>- Machine is in overload protection</li> </ul>
Red burning light in top display with beeping sound	<ul style="list-style-type: none"> <li>- Machine is in overheat protection</li> </ul>


# 8. Exploded views & spare parts list

## 8.1 Exploded views

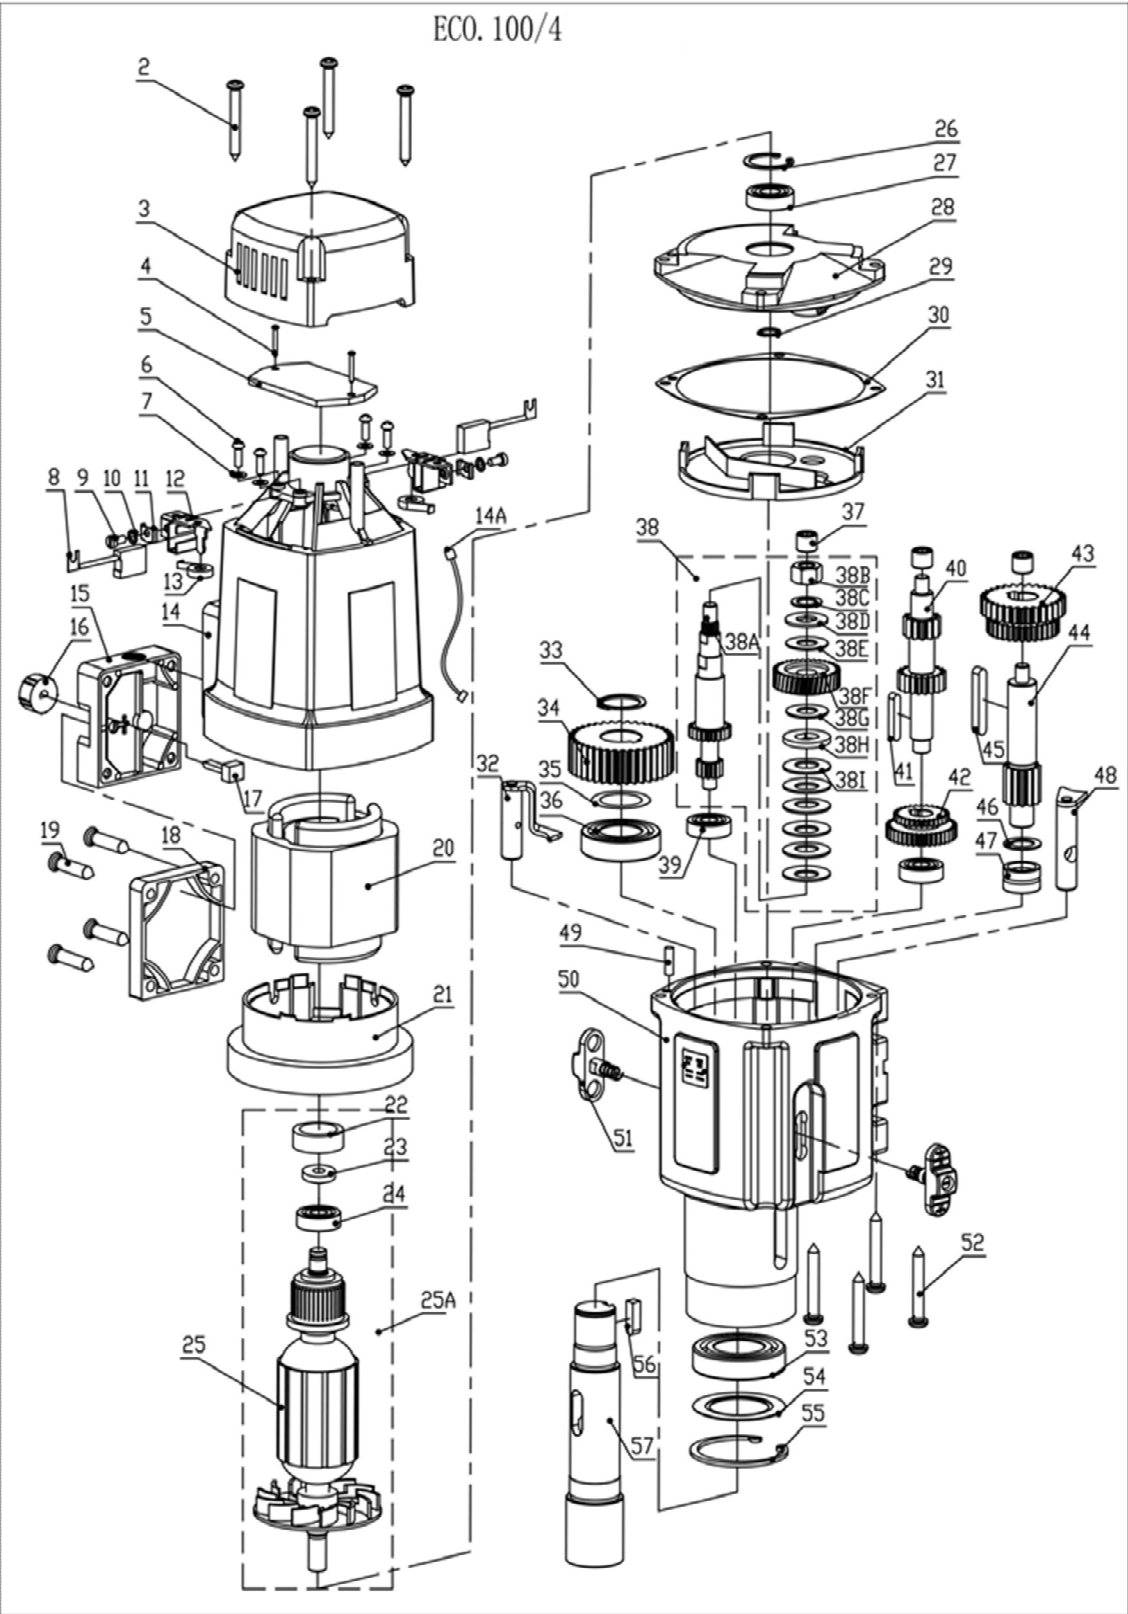





ECO. 100/4D

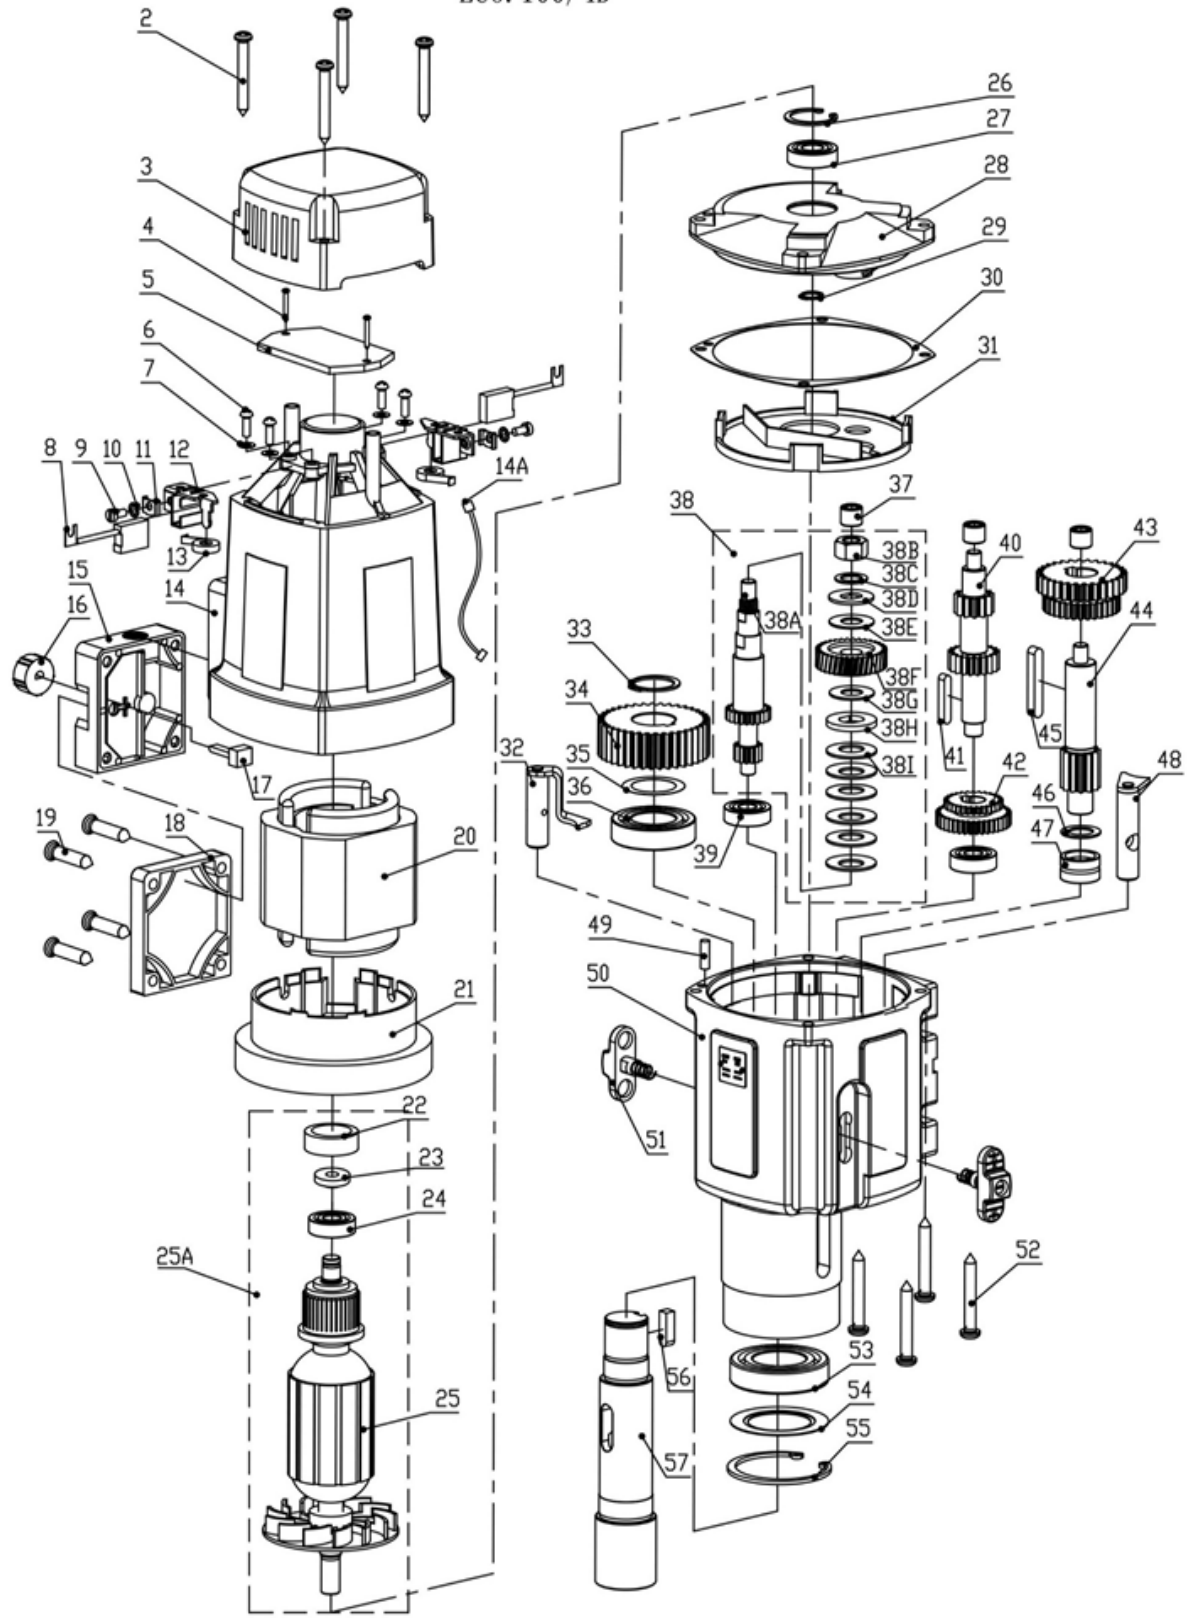


ECC. 100/4

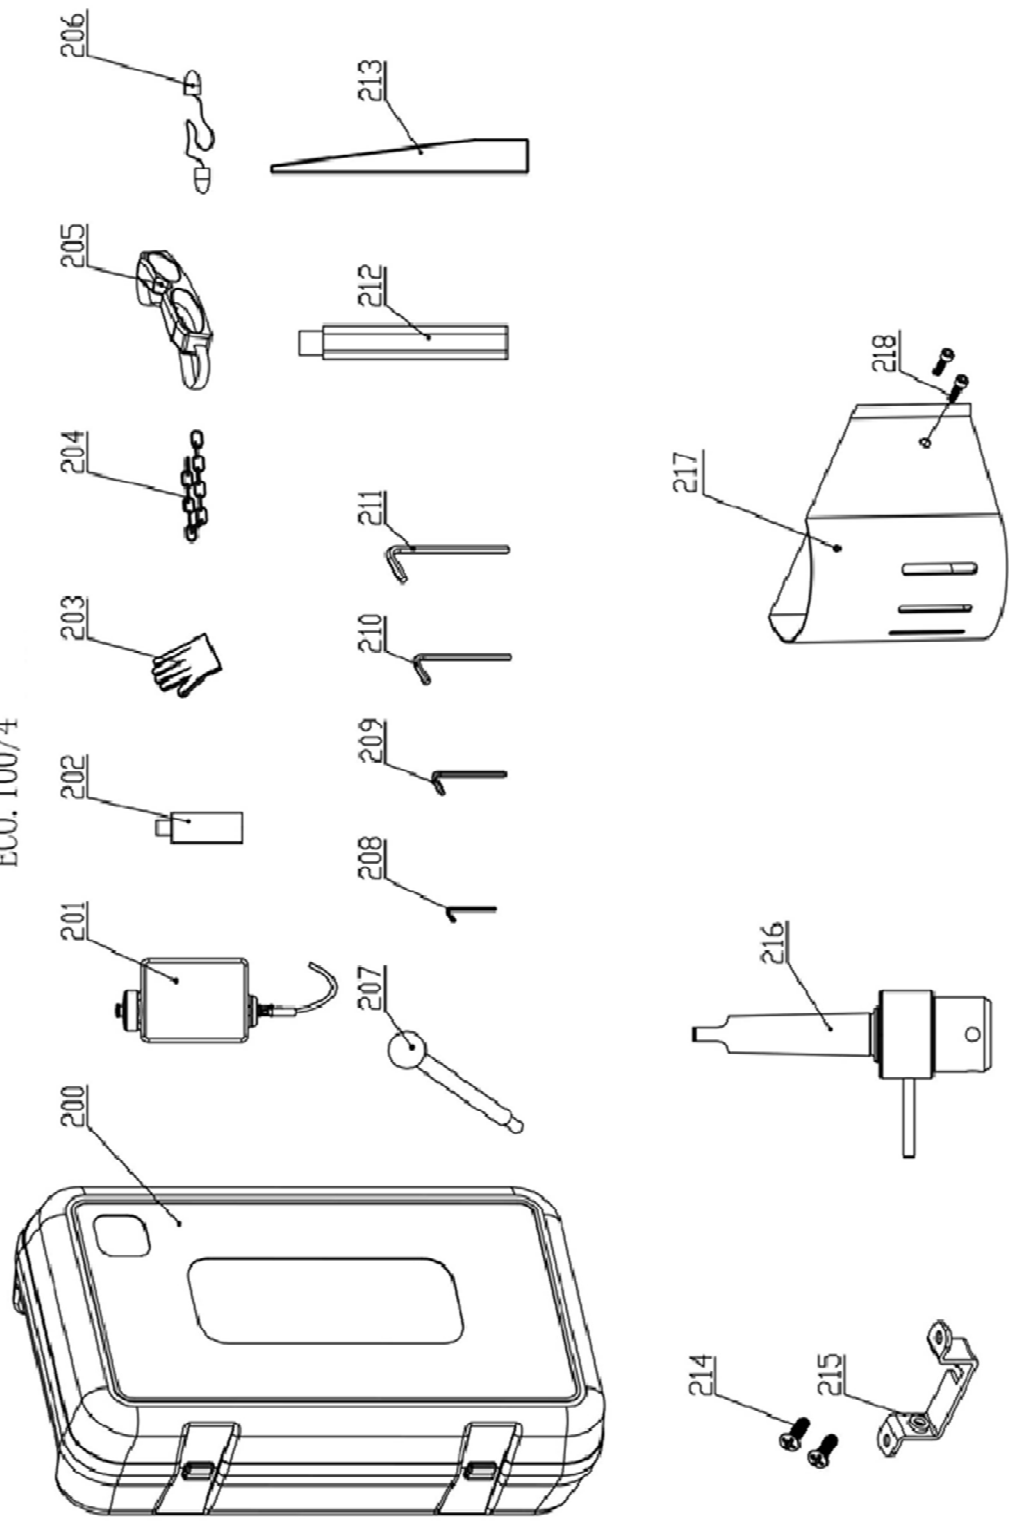


ECO. 100/4D

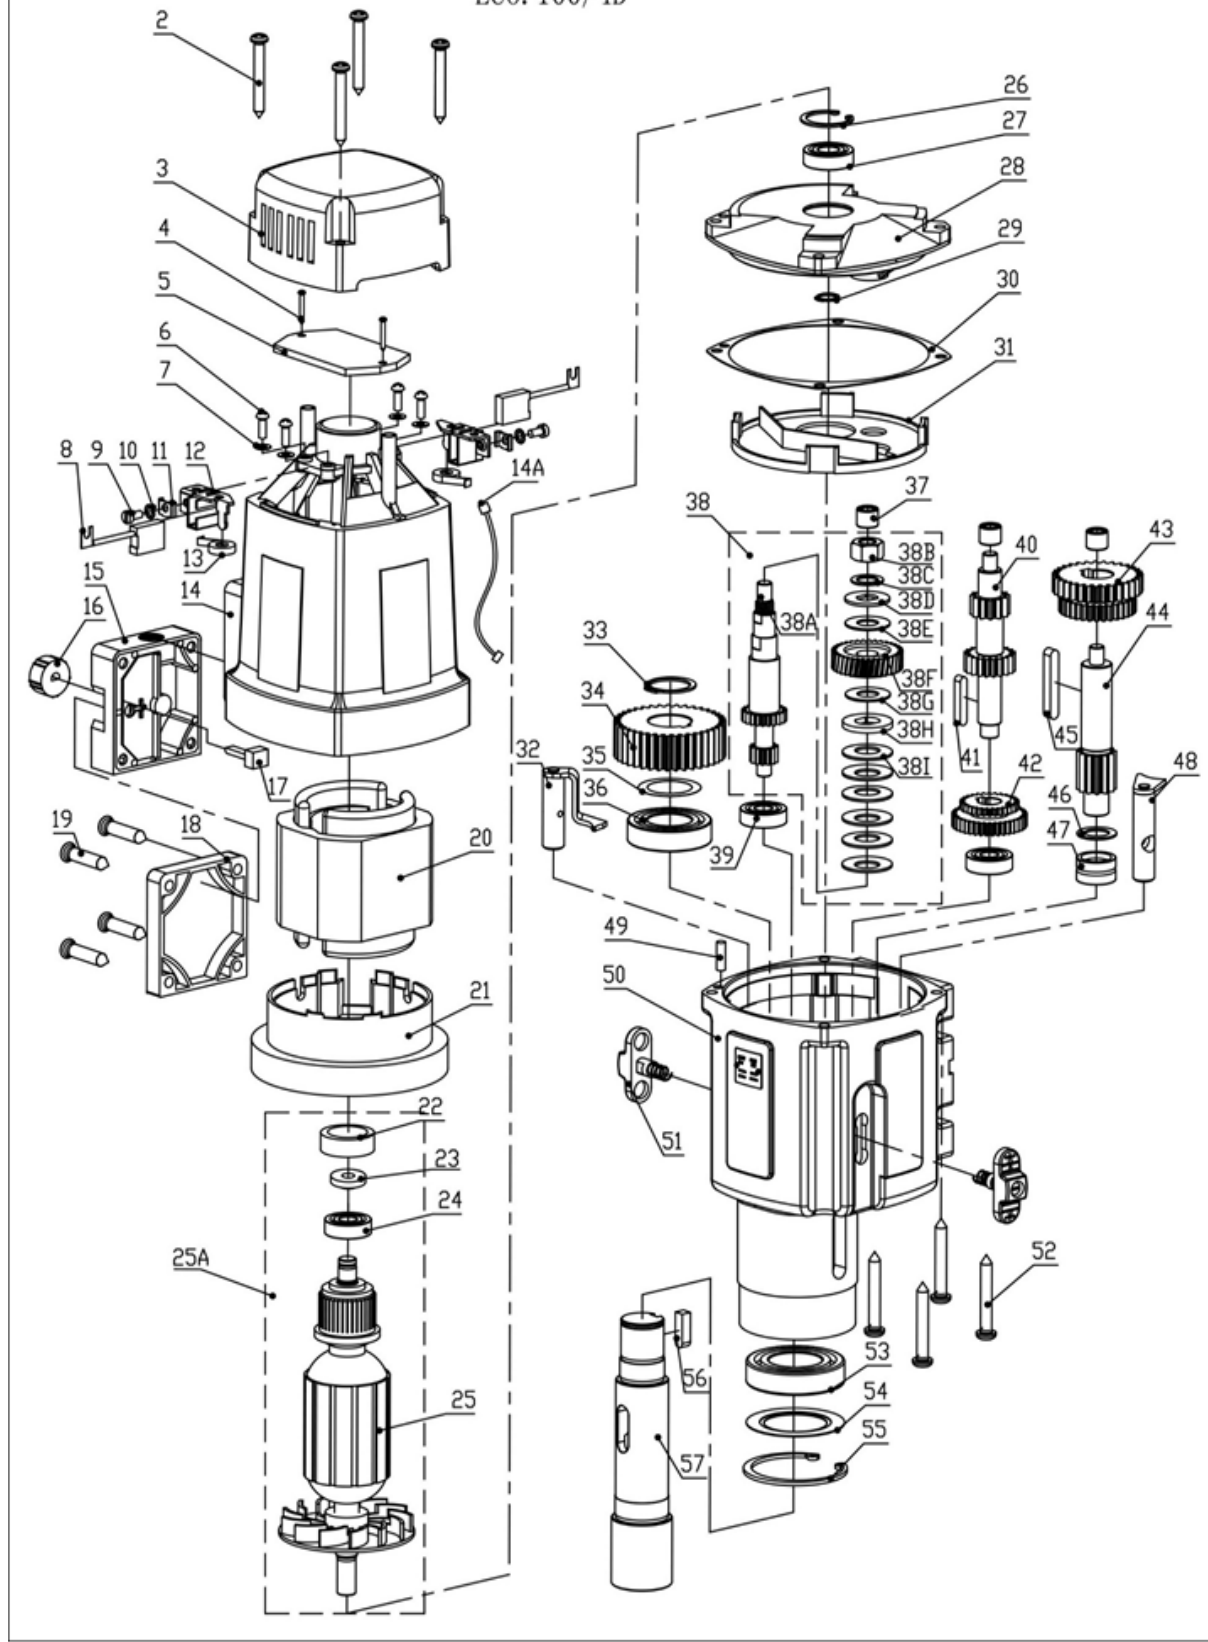

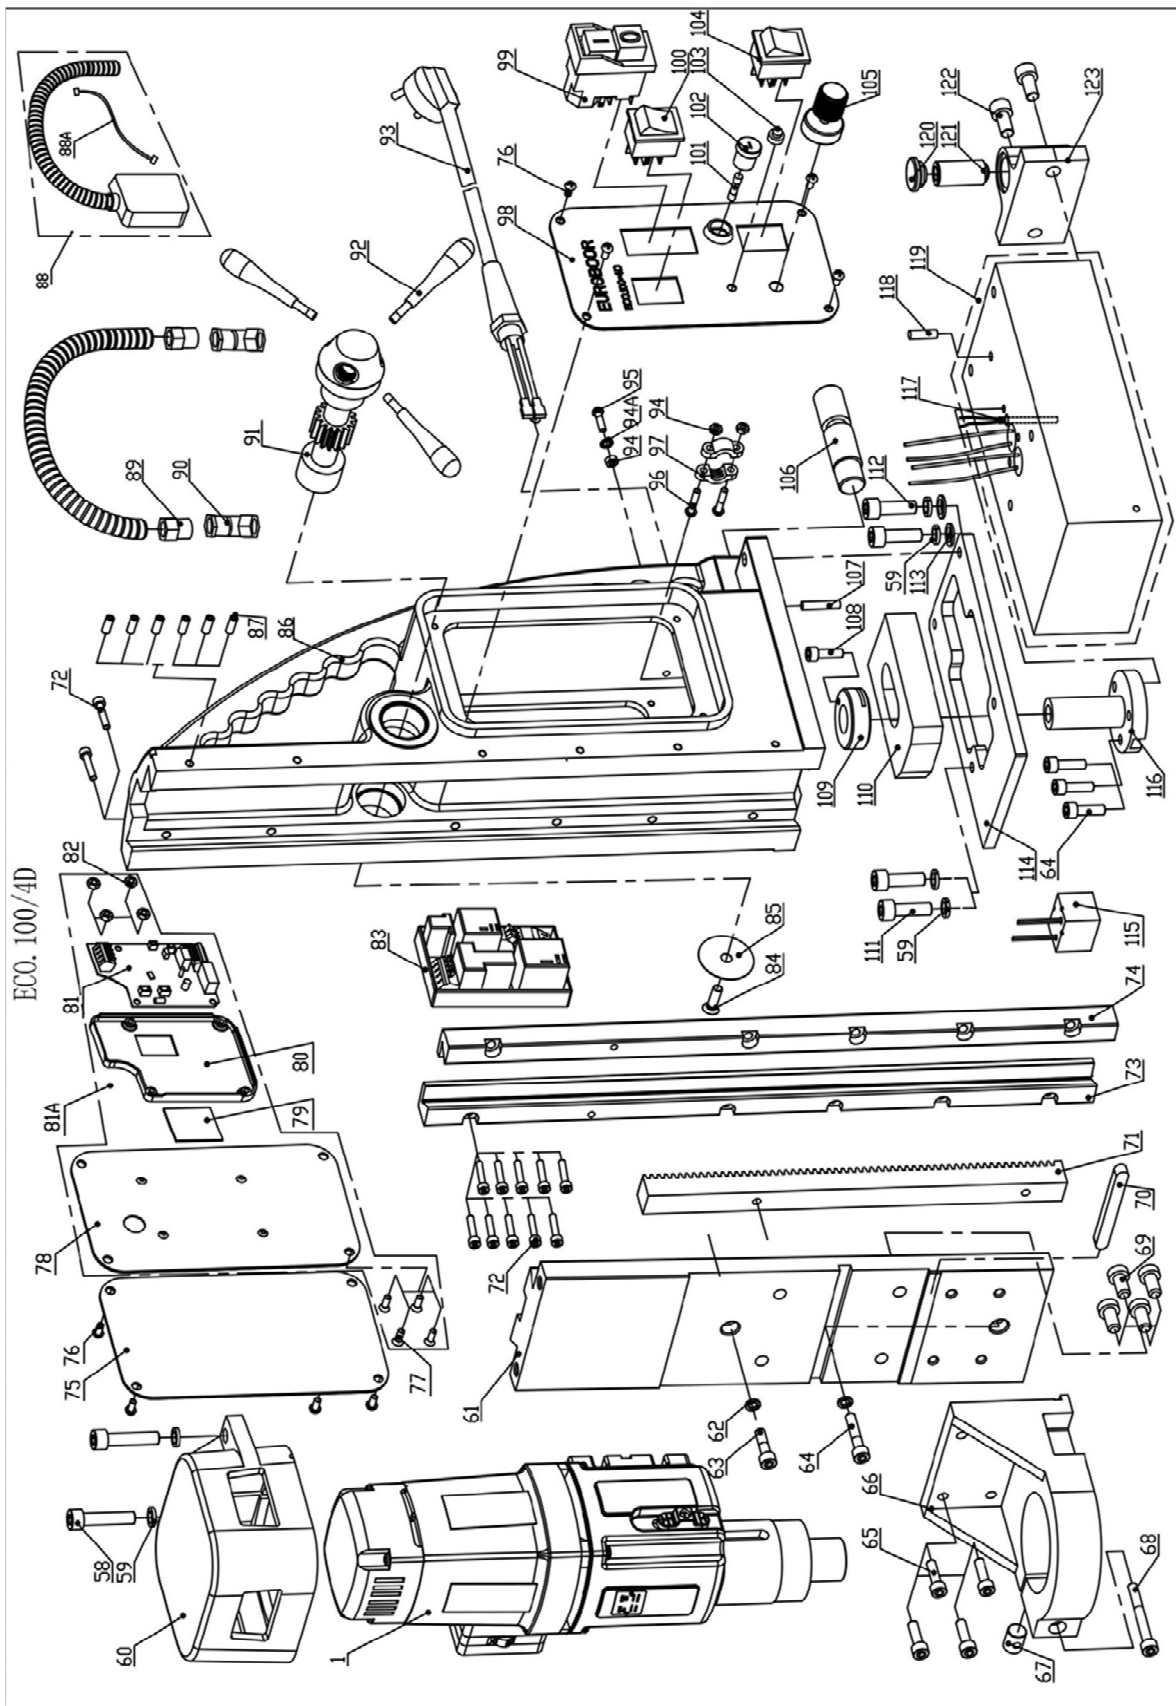

ECO. 100/4D

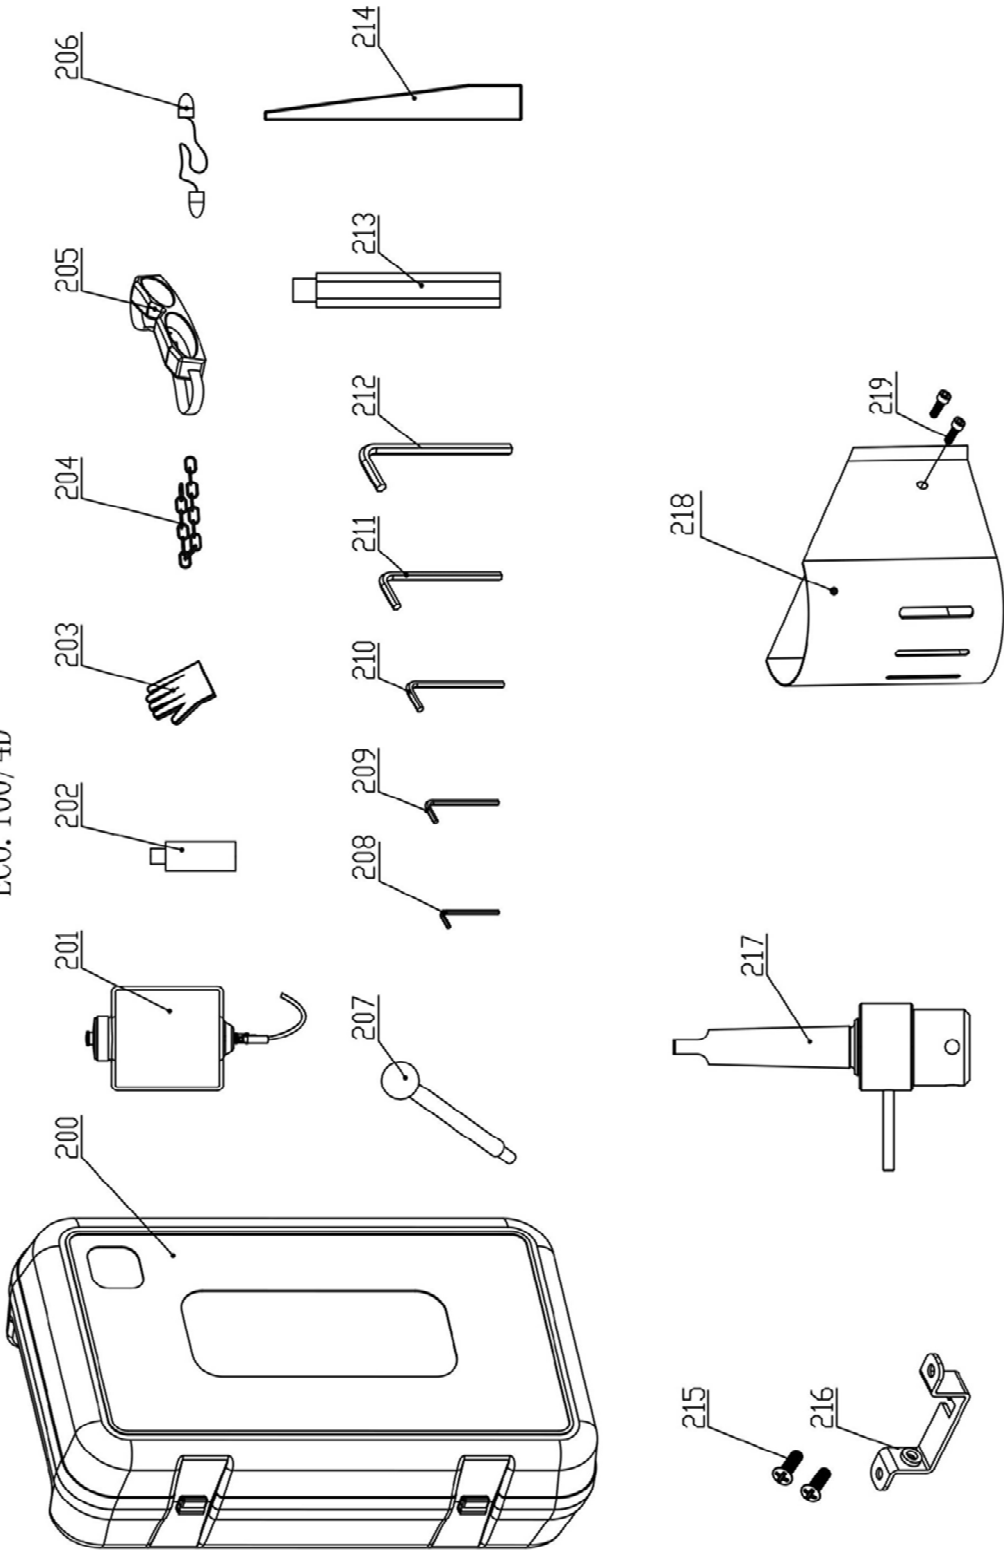

## 8.2 Spare parts lists

### ECO.100/4

No.	Part no.	Description	Qty
1	100.4305	Motor 220V 4-gear (model 2013 -)	1
	100.4306	Motor 110V 4-gear (model 2013 -)	
2	050.0106	Screw 4.8 x 45	4
3	100.0322	End cover	1
4	032.0116	Screw M4 x 16	2
5	100.4006	Control unit top ECO.100 110V / 220V	1
6	100.0372	Carbon brush holder assembly	2
7			
9			
10			
11			
12			
13			
8	100.0368	Carbon brush set 220V	2
	100.0369	Carbon brush set 110V	
14	100.4388	Housing	1
14A	CS100.0342/2	Cable set 1608 ->	1
15	100.4576	Torque switch housing	1
16	100.4574	Wheel red	1
17	100.4573	Torque potenionmeter 1 K	1
18	100.0611	T/S switch cap V1 - V3	1
19	100.0617	Screw PKVZ 6 x 45	4
20	100.1004-CK-1	Field 220V	1
	100.1004A-CK-1	Field 110V	
21	100.0391	Baffle	1
22	100.0346	Rubber fitting ring	1
23	100.0348	Armature speed disk 1800W/1900W	1
24	080.0351	Bearing 6000	1
25A	100.4318	Armature 220V 1900W	1
	100.4319	Armature 110V 1900W	
26	032.0166	Circlip 472/28/1.2	1
27	032.0171	Bearing 6001ZZ 12 x 28 x 8	1
28	080.0401	Inner gear plate	1
29	100.0571	Circlip 471 11 x 1	1
30	100.0458	Gasket big	1
31	100.4621	Plate for gear casing	1
32	100.4342	Clutch shaft 1	1
33	100.0426	Circlip 471 24 x 1.2	1
34	100.4324	Drive shaft gear 1.5 x 38T	1
35	080.4411	Adapter ring	1
36	100.0446	Bearing 6005	1

No.	Part no.	Description	Qty
37	040.0161	Needle bearing HK0810	3
38	100.4312	Friction clutch complete assembly (7T)	1
38A	080.4321	Axle 1 (ECO.80 -> 1412)	1
38B	100.4350	Nut M10	1
38C	100.4351	Washer 12 x 18 x 1	1
38D	100.4338	Friction lock disk 1	1
38E	100.4340	Brass disk 1	1
38F	100.4344	First gear 36T	1
38G	100.4349	Brass disk 2	1
38H	100.4353	Friction lock disk 2	1
38I	100.4352	Tension shell 28	6
39	080.0506	Bearing	2
40	100.4321	Axle 1 28+13T	1
41	040.0301	Key	1
42	100.4491	Double gear 1 25T+39T	1
43	100.4320	Double gear 2 36T+41T	1
44	100.4334	Axle 3 (13T)	1
45	080.0526	Key 3	1
46	100.0486	Washer 14 x 22	1
47	080.0481	Needle bearing	1
48	100.4336	Clutch shaft 2	1
49	100.0549	Casing pin	1
50	100.4327	Gear casing 220V	1
	100.4328	Gear casing 110V	
51	040.0286	Gear switch	2
52	100.0459	Screw BK 5.5 x 45	4
53	100.0466	Bearing 6006	1
54	080.4476	Adapter ring	1
55	100.0471	Circlip 472/55	1
56	080.0431	Key spindle 6 x 6 x 20	1
57	100.0461	Drive shaft 38 x 158	1
58	100.0126	Screw SS M8 x 35	2
59	100.0031	Washer M8	6
60	100.0122	Motor fixing plate	1
61	080.0041	Slide	1
62	020.0111	Washer M6 DIN7980	2
63	020.0146	Screw M6 x 25	1
64	100.0066	Screw SS M6 x 30	1
65	020.0156	Bolt M6 x 20	4
66	100.0046	Motor holder	1
67	100.0046/A	Screw with nut	1
68	100.0071	Screw SS M6 x 55	1
69	100.0076	Rack	1
70	020.0512	Key 8 x 7 x 70	1
71	020.0513	Screw SS M8 x 16	4
72	PP.RLEU-220	Rear panel EB 220V	1
	PP.RLEU-110	Rear panel EB 110V	

No.	Part no.	Description	Qty
73	020.0101	Panel screw BKVZ M4 x 8	8
78A	100.1018	Speed control unit 220V	1
	100.4005	Control unit 1 ECO.100 110V 1501 ->	
80	100.0022	Bolt M5 x 20	12
81	100.0193A	Aluminium rail (L) 22 x 18.5 x 442.5	1
82	100.0193B	Aluminium rail (R) 22 x 18.5 x 442.5	1
83	100.4002	Control unit 2 ECO.100 220V 1501 ->	1
	100.0003	Control unit 110V 1800W	
84	020.0081	End screw BKVZ M6 x 16	1
85	020.0077H	End plate black	1
86	100.4001/X	Frame Mk2	1
87	020.0516	Screw M5 x 10	6
88	100.4610	Motor cable complete V6	1
88A	CS100.0341/2	Cable set 1608 ->	1
89	020.0032	Adapter PG9 - PG11	2
89A	020.0033	Coupling nut PG11	2
90	100.0101H	Capstan hub assembly black	1
91	020.0314X	Arm for capstan	3
92	100.1016	Main cable set 220V EU	1
	100.1016A	Main cable set 110V US	
93	020.0182	Grounding screw/washer/nut	1
93A			
94			
95	PP.100/4EU/4	Front panel EB ECO.100/4 YSW	1
96	100.0152	R/L switch (push) 1800W	1
97	030E.0091/Y	Motor switch 220V (5- pin) YELLOW	1
	030E.0092/Y	Motor switch 110V (5- pin) YELLOW	
98	020.0017	Fuse 5 x 20 F2A	1
99	020.0016	Fuse holder	1
100	020.0206	LED indicator set	1

No.	Part no.	Description	Qty	
101	020.0011/1	Magnet switch	1	
102	100.1009	Potentiometer	1	
93	020.0037	Cable clamp complete	1	
103				
104	020.0151	Magnet spring ball	1	
105				
106				
107				
108	109	100.0006	Screw SS M8 x 25	4
110	100.1008	Sensor	1	
111	020.0305	Washer M8	4	
112	100.0018A	Filter	1	
113	100.0038/1	Magnet 220V 1501 ->	1	
	100.0038/1A	Magnet 110V 1501 ->		
200	CAS.100/6_TR	Case trolley type black no logo	1	
201	KSP.Q2	Coolant tank Quick Connect 2015	1	
202	IBO.0.2L	Bottle 0.2LTR	1	
203	SAF.300	Protective gloves	1	
204	SAF.400	Safety chain (1 mtr) with lock	1	
205	SAF.100	Safety goggles	1	
206	SAF.200	Ear plugs	1	
207	KSP.P	Pin and knob for cooling tank	1	
208	IMB.US2.5	Allen key 2.5 mm	1	
209	IMB.US4	Allen key 4.0 mm	1	
210	IMB.US5	Allen key 5.0 mm	1	
211	IMB.US6	Allen key 6.0 mm	1	
212	100.0051	Stop pin	1	
213	DRIFT3	Drift MT3	1	
214	KSP.MS	Screw M5 x 10	2	
215	KSP.M/3	Tank holder	1	
216	IMC.30/19-N	Arbor MT3 - 19.05 (3/4") Weldon	1	
217	SAF.MDM	Safety guard for ECO.100/4	1	
218	020.0223	Screw M5 x 10	2	

## ECO.100/4 D

No.	Part no.	Description	Qty
1	100.4305	Motor 220V 4-gear (model 2013 -)	1
	100.4306	Motor 110V 4-gear (model 2013 -)	
2	050.0106	Screw 4.8 x 45	4
3	100.0322	End cover	1
4	032.0116	Screw M4 x 16	2
5	100.4006	Control unit top ECO.100 110V / 220V	1
6	100.0372	Carbon brush holder assembly	2
7			
9			
10			
11			
12			
13			
8	100.0368	Carbon brush set 220V	2
	100.0369	Carbon brush set 110V	
14	100.4388	Housing	1
14A	CS100.0342/2	Cable set 1608 ->	1
15	100.4576	Torque switch housing	1
16	100.4574	Wheel red	1
17	100.4573	Torque potentiometer 1 K	1
18	100.0611	T/S switch cap V1 - V3	1
19	100.0617	Screw PKVZ 6 x 45	4
20	100.1004-CK-1	Field 220V	1
	100.1004A-CK-1	Field 110V	
21	100.0391	Baffle	1
22	100.0346	Rubber fitting ring	1
23	100.0348	Armature speed disk 1800W/1900W	1
24	080.0351	Bearing 6000	1
25A	100.4318	Armature 220V 1900W	1
	100.4319	Armature 110V 1900W	
26	032.0166	Circlip 472/28/1.2	1
27	032.0171	Bearing 6001ZZ 12 x 28 x 8	1
28	080.0401	Inner gear plate	1
29	100.0571	Circlip 471 11 x 1	1
30	100.0458	Gasket big	1
31	100.4621	Plate for gear casing	1
32	100.4342	Clutch shaft 1	1
33	100.0426	Circlip 471 24 x 1.2	1
34	100.4324	Drive shaft gear 1.5 x 38T	1
35	080.4411	Adapter ring	1
36	100.0446	Bearing 6005	1


No.	Part no.	Description	Qty
37	040.0161	Needle bearing HK0810	3
38	100.4312	Friction clutch complete assembly (7T)	1
38A	080.4321	Axle 1 (ECO.80 -> 1412)	1
38B	100.4350	Nut M10	1
38C	100.4351	Washer 12 x 18 x 1	1
38D	100.4338	Friction lock disk 1	1
38E	100.4340	Brass disk 1	1
38F	100.4344	First gear 36T	1
38G	100.4349	Brass disk 2	1
38H	100.4353	Friction lock disk 2	1
38I	100.4352	Tension shell 28	6
39	080.0506	Bearing	2
40	100.4321	Axle 1 28+13T	1
41	040.0301	Key	1
42	100.4491	Double gear 1 25T+39T	1
43	100.4320	Double gear 2 36T+41T	1
44	100.4334	Axle 3 (13T)	1
45	080.0526	Key 3	1
46	100.0486	Washer 14 x 22	1
47	080.0481	Needle bearing	1
48	100.4336	Clutch shaft 2	1
49	100.0549	Casing pin	1
50	100.4327	Gear casing 220V	1
	100.4328	Gear casing 110V	
51	040.0286	Gear switch	2
52	100.0459	Screw BK 5.5 x 45	4
53	100.0466	Bearing 6006	1
54	080.4476	Adapter ring	1
55	100.0471	Circlip 472/55	1
56	080.0431	Key spindle 6 x 6 x 20	1
57	100.0461	Drive shaft 38 x 158	1
58	100.0126	Screw SS M8 x 35	2
59	100.0031	Washer M8	6
60	100.0122	Motor fixing plate	1
61	080.0041	Slide	1
62	020.0111	Washer M6 DIN7980	2
63	020.0146	Screw M6 x 25	1
64	100.0066	Screw SS M6 x 30	4
65	020.0156	Bolt M6 x 20	4
66	100.0046	Motor holder	1
67	100.0046/A	Screw with nut	1
68	100.0071	Screw SS M6 x 55	1
69	020.0513	Screw SS M8 x 16	4
70	020.0512	Key 8 x 7 x 70	1
71	100.0076	Rack	1
72	100.0022	Bolt M5 x 20	12



No.	Part no.	Description	Qty
73	100.0193A	Aluminium rail (L) 22 x 18.5 x 442.5	1
74	100.0193B	Aluminium rail (R) 22 x 18.5 x 442.5	1
75	PP.RLEU-220	Rear panel EB 220V	1
	PP.RLEU-110	Rear panel EB 110V	
76	020.0101	Panel screw BKVZ M4 x 8	8
81A	100.1018	Speed control unit 220V	1
	100.4005	Control unit 1 ECO.100 110V 1501 ->	
83	100.4002	Control unit 2 ECO.100 220V 1501 ->	1
	100.0003	Control unit 110V 1800W	
84	020.0081	End screw BKVZ M6 x 16	1
85	020.0077H	End plate black	1
86	100.4001/D	Frame ECO.100/4 D	1
87	020.0516	Screw M5 x 10	6
88	100.4610	Motor cable complete V6	1
88A	CS100.0341/2	Cable set 1608 ->	1
89	020.0032	Adapter PG9 - PG11	2
90	020.0033	Coupling nut PG11	2
91	100.0101H	Capstan hub assembly black	1
92	020.0314X	Arm for capstan	3
93	100.1016	Main cable set 220V EU	1
	100.1016A	Main cable set 110V US	
94	020.0182	Grounding screw/washer/nut	1
94A			
95			
96	020.0037	Cable clamp complete	1
97			
98	PP.100/4DEU/4	Front panel EB ECO.100/4D YSW	1
99	030E.0091/Y	Motor switch 220V (5-pin) YELLOW	1
	030E.0092/Y	Motor switch 110V (5-pin) YELLOW	
100	100.0152	R/L switch (push) 1800W	1
101	020.0017	Fuse 5 x 20 F2A	1
102	020.0016	Fuse holder	1
103	020.0206	LED indicator set	1
104	020.0011/1	Magnet switch	1

No.	Part no.	Description	Qty
105	100.1009	Potentiometer	1
106	3D-04	Eccentric shaft	1
107	020.0004	Pin 5 x 25	1
108	020.0074	Screw M5 x 12	1
109	3D-02	Adapter sleeve	1
110	3D-01Z	Pressing plate 96 x 54 x 20	1
111	100.0007	Screw SS M8 x 22	2
112	100.0006	Screw SS M8 x 25	2
113	020.0305	Washer M8	2
114	0053L	Connecting plate	1
115	100.0018A	Filter	1
116	3D-03	Connecting screw rod	1
117	100.1008	Sensor	1
118	020.0003	Pin	1
119	100.0038-D	Magnet 220V D-system	1
	100.0038-DA	Magnet 110V D-system	
120	020.0151	Magnet spring ball	1
121			
122			
123			
200	CAS.100/6_TR	Case trolley type black no logo	1
201	KSP.Q2	Coolant tank Quick Connect 2015	1
202	IBO.0.2L	Bottle 0.2LTR	1
203	SAF.300	Protective gloves	1
204	SAF.400	Safety chain (1 mtr) with lock	1
205	SAF.100	Safety goggles	1
206	SAF.200	Ear plugs	1
207	KSP.P	Pin and knob for cooling tank	1
208	IMB.US2.5	Allen key 2.5 mm	1
209	IMB.US4	Allen key 4.0 mm	1
210	IMB.US5	Allen key 5.0 mm	1
211	IMB.US6	Allen key 6.0 mm	1
212	IMB.US8	Allen key 8.0 mm	1
213	100.0051	Stop pin	1
214	DRIFT3	Drift MT3	1
215	KSP.MS	Screw M5 x 10	2
216	KSP.M/3	Tank holder	1
217	IMC.30/19-N	Arbor MT3 - 19.05 (3/4") Weldon	1
218	SAF.MDM	Safety guard for ECO.100/4	1
219	020.0223	Screw M5 x 10	2

### 8.3 Wiring diagram

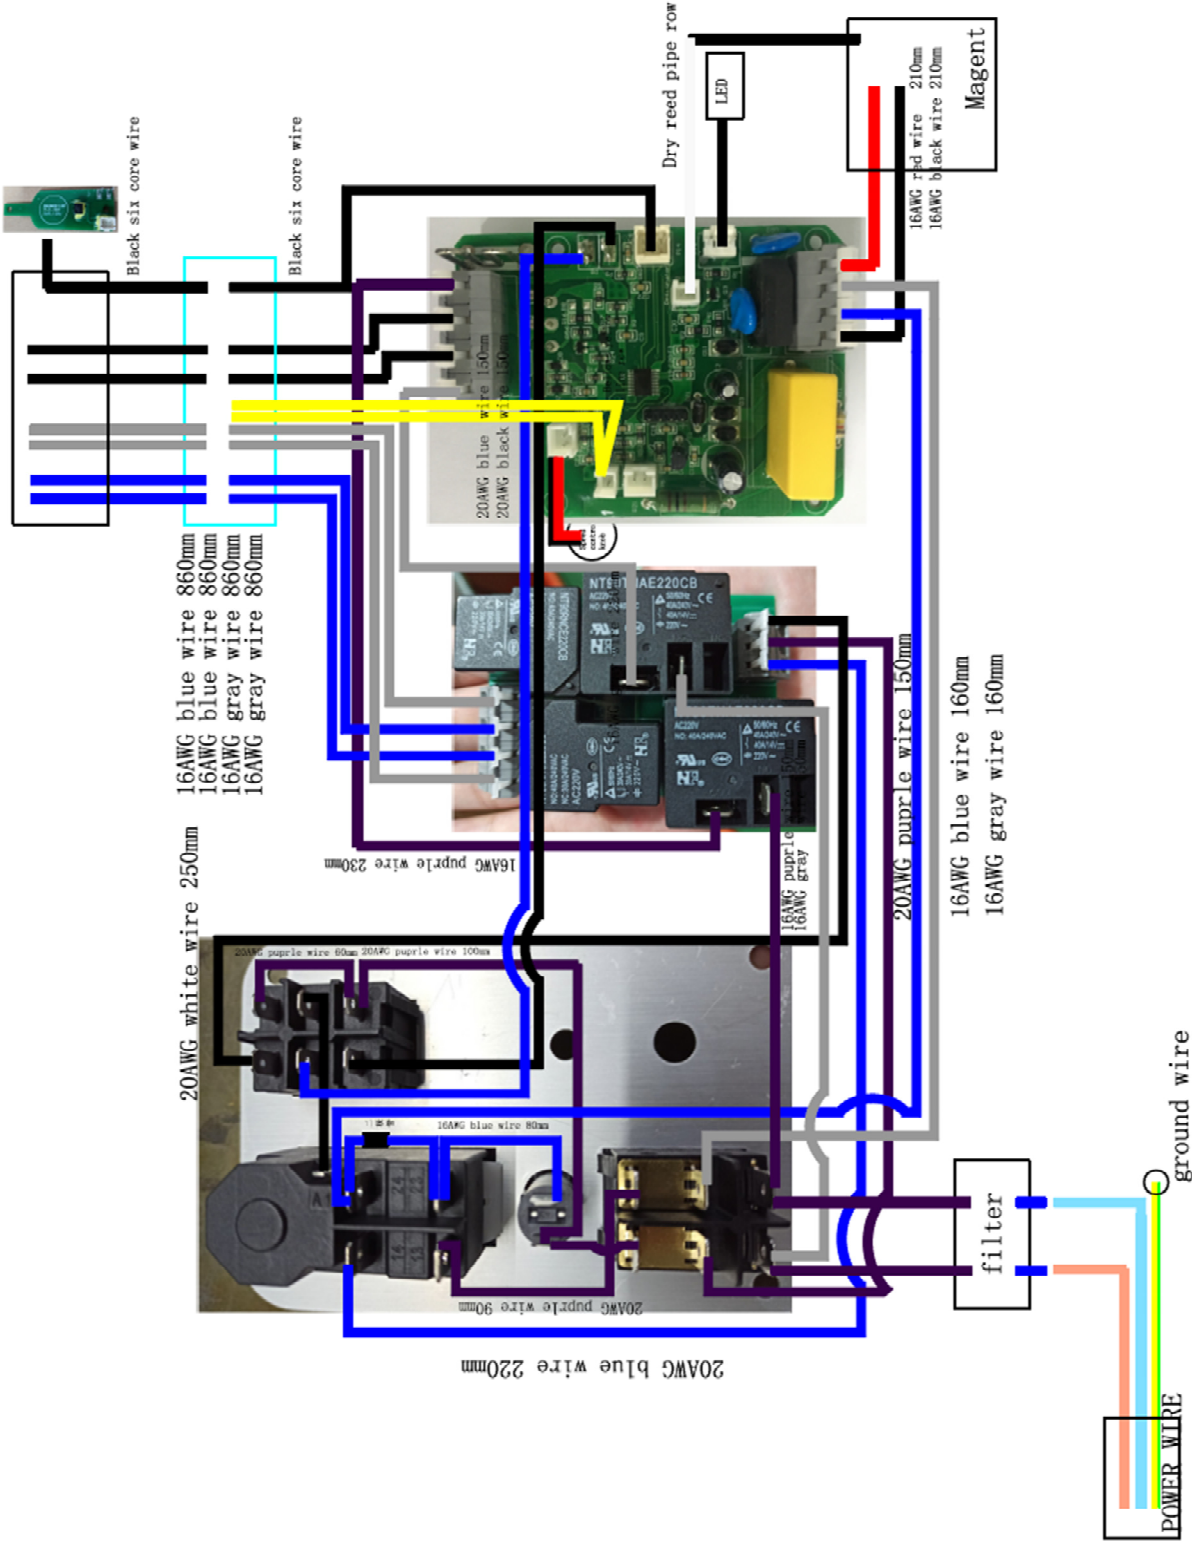

## **8.4 Warranty and service**

### **Warranty**

Euroboor B.V. warrants this magnetic drilling machine to be free of material defects and workmanship errors under normal use for a period of 12 months after date of purchase.

This 12 month period can be extended to 24 months in total by registering the product on our website: <https://euroboor.com/support/register/>

### **Service**

To maximise the lifetime of your EUROBOOR machine always use service and parts from an official EUROBOOR distribution channel. Whenever in need of such, always contact original point of sales or if no longer existent the distributor of EUROBOOR products in your country.